


<b>EASA</b>	<b>AIRWORTHINESS DIRECTIVE</b>
	<p><b>AD No.: 2014-0217R1</b></p> <p><b>Date: 26 February 2015</b></p> <p>Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.</p>
<p>This AD is issued in accordance with EU 748/2012, Part 21.A.3B. In accordance with EU 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [EU 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [EC 216/2008, Article 14(4) exemption].</p>	
<p><b>Design Approval Holder's Name:</b> AIRBUS</p>	<p><b>Type/Model designation(s):</b> A318, A319, A320 and A321 aeroplanes</p>
<p>TCDS Number: EASA.A.064</p>	
<p>Foreign AD: Not applicable</p>	
<p>Revision: This AD revises EASA AD 2014-0217 dated 26 September 2014.</p>	
<p><b>ATA 22, 31</b></p>	<p><b>Auto Flight / Instruments – Stop Rudder Input Warning – Installation / Activation</b></p>
<p><b>Manufacturer(s):</b></p>	<p>Airbus (formerly Airbus Industrie)</p>
<p><b>Applicability:</b></p>	<p>Airbus A318-111, A318-112, A318-121, A318-122, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-131, A321-211, A321-212, A321-213, A321-231 and A321-232 aeroplanes, all manufacturer serial numbers.</p>
<p><b>Reason:</b></p>	<p>During design reviews that were conducted following safety recommendations related to in-service incidents and one accident on another aircraft type, it has been determined that, in specific flight conditions, the allowable load limits on the vertical tail plane could be reached and possibly exceeded.</p> <p>This condition, if not corrected, could lead, in the worst case, to detachment of the vertical tail plane in flight and consequent loss of the aeroplane.</p> <p>To prevent such a possibility, Airbus has developed modifications within the flight augmentation computer (FAC) to reduce the vertical tail plane stress and to activate a conditional aural warning within the flight warning computer (FWC) to further protect against pilot induced rudder doublets.</p> <p>Consequently, EASA issued AD 2014-0217 to require installation and activation of the stop rudder input warning (SRIW) logic. In addition, that AD required, prior to or concurrent with modification of an aeroplane with the activation of the SRIW, upgrades of the FAC and FWC, to introduce the SRIW logic and SRIW aural capability, respectively. After modification, the AD prohibited installation of certain Part Number (P/N) FWC and FAC.</p>

	<p>Since that AD was issued, an additional previously-published Airbus Service Bulletin (SB) was identified, and a new SB was published, for the concurrent requirement to replace the FAC with a unit having a P/N as listed in Table 3 of Appendix 1 of the AD.</p> <p>For the reasons described above, this AD is revised to amend paragraph (2), adding references to additional Airbus SBs.</p>
Effective Date:	<p>Revision 1: 05 March 2015</p> <p>Original issue: 10 October 2014</p>
Required Action(s) and Compliance Time(s):	<p>Required as indicated, unless accomplished previously:</p> <ol style="list-style-type: none"> <li>(1) Within 48 months after 10 October 2014 [the effective date of the original issue of this AD], modify the pin programming to activate the SRIW logic in accordance with the instructions of Airbus Service Bulletin (SB) A320-22-1480.</li> <li>(2) Prior to, or concurrent with, modification of an aeroplane as required by paragraph (1) of this AD, identify the P/N of the FWC and of the FAC installed on the aeroplane and, if the FWC and/or FAC P/N installed on aeroplane is listed in Table 1 or Table 2 of Appendix 1 of this AD, replace the FWC and/or FAC, as applicable, with a unit having a P/N listed in the Table 3 of Appendix 1 of this AD <p>This can be accomplished in accordance with the instructions of Airbus SB A320-22-1375 (FAC 621 hard B), or SB A320-22-1427 (FAC 622 hard B), or SB A320-22-1461 (FAC 623 hard B), or SB A320-22-1447 (FAC A02 hard C), or SB A320-22-1454 (FAC CAA02 hard C), or SB A320-22-1502 (FAC CAA02 hard C), as applicable to aeroplane model and configuration, and Airbus SB A320-31-1414 (FWC H2-F7).</p> </li> <li>(3) An aeroplane on which Airbus modification (mod) 154473 has been embodied in production is compliant with the requirements of paragraphs (1) and (2) of this AD, provided it is determined that no FWC having a P/N listed in Table 1, and no FAC having a P/N listed in Table 2, respectively, of Appendix 1 of this AD, has been installed on that aeroplane since Airbus date of manufacture. <p>If a post-mod 154473 aeroplane is found to be no longer in the correct configuration, before next flight after the effective date of this AD, restore the aeroplane to its correct configuration as specified in paragraph (2) of this AD.</p> </li> <li>(4) After modification of an aeroplane as required by paragraph (1) of this AD, or restored as required by paragraph (3) of this AD, as applicable, do not install on that aeroplane a FWC having a P/N listed in Table 1, or a FAC having a P/N listed in Table 2, as applicable, of Appendix 1 of this AD.</li> <li>(5) Installation of a version (P/N) of the FWC or FAC approved after 10 October 2014 [the effective date of the original issue of this AD] is equal to compliance with the requirements of paragraph (2) or (3) of this AD, provided the conditions as specified in paragraphs (5.1) and (5.2) of this AD are met. <ol style="list-style-type: none"> <li>(5.1) The version (P/N) must be approved by EASA, or approved under Airbus Design Organisation Approval (DOA); and</li> <li>(5.2) The installation must be accomplished in accordance with aeroplane modification instructions approved by EASA, or approved under Airbus DOA.</li> </ol> </li> </ol>

Ref. Publications:	<p>Airbus SB A320-22-1375 original issue dated 15 January 2014.</p> <p>Airbus SB A320-22-1427 original issue dated 25 January 2013.</p> <p>Airbus SB A320-22-1447 original issue dated 18 October 2013.</p> <p>Airbus SB A320-22-1461 original issue dated 31 October 2013.</p> <p>Airbus SB A320-22-1480 original issue dated 09 July 2014.</p> <p>Airbus SB A320-22-1454 original issue dated 12 February 2014.</p> <p>Airbus SB A320-22-1502 original issue dated 14 November 2014.</p> <p>Airbus SB A320-31-1414 original issue dated 19 December 2012.</p> <p>The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.</p>
Remarks:	<ol style="list-style-type: none"> <li>1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.</li> <li>2. The original issue of this AD was posted on 23 July 2014 as PAD 14-119 for consultation until 20 August 2014. The Comment Response Document can be found at <a href="http://ad.easa.europa.eu/">http://ad.easa.europa.eu/</a>.</li> <li>3. Enquiries regarding this AD should be referred to the Safety Information Section, Certification Directorate, EASA. E-mail: <a href="mailto:ADs@easa.europa.eu">ADs@easa.europa.eu</a>.</li> <li>4. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – EIAS; Fax +33 5 61 93 44 51; E-mail: <a href="mailto:account.airworth-eas@airbus.com">account.airworth-eas@airbus.com</a>.</li> </ol>

## Appendix 1

Table 1 – FWC P/N non-compatible with SRIW activation

350E017238484 (H1D1)	350E053020303 (H2E3)
350E016187171 (C5)	350E053020404 (H2E4)
350E017248685 (H1D2)	350E053020606 (H2F2)
350E017251414 (H1E1)	350E053020707 (H2F3)
350E017271616 (H1E2)	350E053021010 (H2F3P)
350E018291818 (H1E3CJ)	350E053020808 (H2F4)
350E018301919 (H1E3P)	350E053020909 (H2-F5)
350E018312020 (H1E3Q)	350E053021111 (H2-F6)
350E053020202 (H2E2)	

Table 2 – FAC P/N non-compatible with SRIW activation

B397AAM0202	B397BAM0101	B397BAM0512
B397AAM0301	B397BAM0202	B397BAM0513
B397AAM0302	B397BAM0203	B397BAM0514
B397AAM0303	B397BAM0305	B397BAM0515
B397AAM0404	B397BAM0406	B397BAM0616
B397AAM0405	B397BAM0407	B397BAM0617
B397AAM0506	B397BAM0507	B397BAM0618
B397AAM0507	B397BAM0508	B397BAM0619
B397AAM0508	B397BAM0509	B397BAM0620
B397AAM0509	B397BAM0510	B397CAM0101
B397AAM0510	B397BAM0511	B397CAM0102
Soft P/N G2856AAA01 installed on hard P/N C13206AA00		

Table 3 – FWC and FAC compatible with SRIW activation

<b>Aeroplane Configuration</b>	<b>Minimum Installation</b>
All, no sharklet	FAC P/N B397BAM0621 (621 hard B)
Sharklet A320 and A319	FAC P/N B397BAM0622 (622 hard B)
Sharklet A321	FAC P/N B397BAM0623 (623 hard B)
All (with or without sharklet)	FAC soft P/N G2856AAA02 installed on hard P/N C13206AA00 (CAA02 hard C)
	FWC P/N 350E053021212 (H2-F7)