


EASA	EMERGENCY AIRWORTHINESS DIRECTIVE
	<p>AD No.: 2009-0169-E</p> <p>Date: 30 July 2009</p> <p>Note: This Emergency Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.</p>
This AD is issued in accordance with EC 1702/2003, Part 21A.3B. In accordance with EC 2042/2003 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD unless otherwise specified by the Agency [EC 2042/2003 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [EC 216/2008, Article 14(4) exemption].	
Type Approval Holder's Name : DG Flugzeugbau GmbH	Type/Model designation(s) : DG-500 MB and DG-800 B Powered Sailplanes
TCDS Number : LBA No. 843/PS and EASA.A.067	
Foreign AD : Not applicable	
Supersedure : None	
ATA 80	Starting - Zinc Coated Starter Ring Gears - Inspections / Replacement
Manufacturer(s):	DG Flugzeugbau GmbH
Applicability:	Model DG-500 MB and DG-800 B powered sailplanes, all serial numbers.
Reason:	It has been determined that zinc-coated starter ring gears installed on Solo 2625 01 and 2625 02 engines are prone to cracking. Cracks could be the result of hydrogen embrittlement due to the zinc-plating process. As a consequence, this new Airworthiness Directive (AD) mandates repetitive inspections of zinc-coated starter ring gears and their replacement when damage is found.
Effective Date:	03 August 2009
Required Action(s) and Compliance Time(s):	Required as indicated, unless accomplished previously: (1) Before further flight after the effective date of this AD, identify the installed version of the starter ring gear (zinc-coated or painted) in accordance with paragraph 1. of the instructions of DG-Flugzeugbau Technical Note (TN) No. 800/36 initial issue or TN No. 843/30 initial issue. (Thereafter named 'the Technical Notes').

	<p>(2) If a zinc-coated starter ring gear is found, before further flight inspect the gear for cracks as instructed in paragraph 2 of the Technical Notes.</p> <p>(2.1) if any crack is found, before further engine operation, replace the starter ring gear as instructed in paragraph 3 of the Technical Notes.</p> <p>(2.2) If no crack is found and until accomplishment of paragraph (3) of this AD, do repetitive inspections of the zinc-coated starter ring gear during every pre-flight check as instructed in paragraphs 2 and 3 of the Technical Notes.</p> <p>(3) At the operator's discretion, replace the zinc-coated starter ring gear with a painted starter ring gear as instructed in paragraph 3 of the Technical Notes.</p> <p>Installation of a painted starter ring gear terminates the repetitive inspection requirements of paragraph (2.2) of this AD.</p> <p><u>Limited Pilot-Owner Maintenance</u></p> <p>When/Where Part-M applies the inspection requirements of this AD, can be done under the scope of the limited pilot-owner maintenance authorisation.</p>
Ref. Publications:	<p>DG-Flugzeugbau Technical Notes No. 800/36 and 843/30, both at initial issue, dated 15 July 2009;</p> <p>The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.</p>
Remarks :	<ol style="list-style-type: none"> 1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD. 2. The safety assessment has requested not to implement the full consultation process and an immediate publication and notification. 3. Enquiries regarding this AD should be referred to the Airworthiness Directives, Safety Management & Research Section, Certification Directorate, EASA. E-mail: ADs@easa.europa.eu. 4. For any questions concerning the technical content of the requirements in this AD, please contact: <p style="text-align: center;"> DG-Flugzeugbau GmbH Otto Lilienthal Weg 2 / Am Flugplatz 76646 Bruchsal GERMANY Tel.: +49 (0) 7251 3020-0 Fax: +49 (0) 7251 3020-200 </p>