

AIRWORTHINESS DIRECTIVE
RELEASED BY THE SECRETARIAT GENERAL
FOR CIVIL AVIATION

The inspections or modifications described below are mandatory. Failure to comply with Airworthiness Directives entails suspension of the Certificate of Airworthiness (see decree regarding airworthiness requirements for civil aircraft).

Avions MARCEL DASSAULT/BREGUET AVIATION/FAN JET FALCON (all models)

Main landing gear - L/G actuators
MESSIER HISPANO P/N A 23721 and A 23722

This airworthiness directive concerns the L/G actuators serial numbers 1 thru 820 (included) except 808, 814, 817, 819 not modified in accordance with AMD Service Bulletin n° 529.

1. It is mandatory that the L/G actuators S/N 1 thru 699 be inspected, if not already done, in accordance with instructions provided by the manufacturer in AMD Service Bulletin n° 528 rev. 2 within the next 50 flight hours or three months following the date of effectivity of this directive, whichever comes first.
2. It is mandatory that the L/G actuators S/N 700 thru 820 except 808, 814, 815, 817, 819 be inspected, if not already done, in accordance with instructions provided by the manufacturer in Service Bulletin n° 528 rev. 2 within the next 200 flight hours or six months following the date of effectivity of this directive, whichever comes first.
3. Actuators found badly corroded (see criterions defined in SB 528) during inspection in accordance with para. 1 and 2 of this A D, will imperatively have to be removed within three months following the inspection in order to be modified in accordance with instructions provided by the manufacturer in AMD Service Bulletin n° 529.
4. Actuators found moderately, slightly or not corroded (see criterions defined in SB 528) during inspection in accordance with para. 1 and 2 of this AD will have to be periodically inspected every 5 months at maximum in accordance with the instructions provided by the manufacturer in AMD Service Bulletin n° 528 rev.2.

NOTE : Compliance with the modification described by the manufacturer in AMD Service Bulletin n° 529 eliminates the requirement to perform the inspections of para 1, 2 and 4 above.

AMD SB n° 528 rev. 2
AMD SB n° 529

Translation of "Consigne de Navigabilité

RÉF. 76-15-9 (B)

In case of any difficulty, reference should be made to the French original text.

Date : 2.2.76

Material : Avions MARCEL DASSAULT/
BREGUET AVIATION/ FAN JET
FALCON (all models)

Reference : 76-15-9 (B)