

Ministerio de Fomento Subsecretaría Dirección General de Aviación Civil

AIRWORTHINESS

DIRECTIVE

NUMBER:

02/88 Rev. 3

SHEET:

1/1

AFFECTED PRODUCT:

Aircraft CASA C-212-CB

C-212-CC C-212-CD C-212-CE C-212-CF

C-212-VA C-212-DD C-212-DF

MANUFACTURER:

CONSTRUCCIONES AERONAUTICAS S.A. (EADS-CASA).

ISSUE DATE:

. 2004.

REFERENCE:

CASA Document C-212-PV-02-SID dated June 1, 1997 or later approved

revisions.

EFFECTIVE:

Upon reception.

DESCRIPTION:

In order to maintain the structural integrity of the CASA C-212 airplanes throughout their operational life, the principal structural elements (PSE) corresponding to the referred airplane type must be inspected in accordance with the document in reference section of this Airworthiness Directive... Additionally, and only for -CB model airplane, the horizontal stabilizer to fuselage attachments, part number 212-31101.05 and part number 212-

COMPLIANCE SCHEDULE: According to the threshold and intervals established in the referenced

31102.05 must be replace by other new ones with same part number.

document.

For airplanes operating more than 10% of their flights at lower height than 3000 feet or with a average flight duration excedding 80 minutes, the operator must contact Construcciones Aeronáuticas, in order to confirm the applicability to these airplanes of the inspection requirements established in the document, or adjust them to his particular type of operation. In any of these above two cases, at the accumulation of 20000 landings or 20000 flight hours, whichever occurs first, the airplane will not be released to service unless a conformity document of the manufacturer relative to the above stated condition,

acceptable to the corresponding civil aviation authority, is obtained.

Airplanes model -CB: Replace elements 212-31101.05 and 212-31102.05

prior the accumulation of 16500 landings.

ADDITIONAL INFORMATION: For further information contact:

Dirección General de Aviación Civil.

Attn: J. A. Basañez.

Paseo de la Castellana, 67. 28071 Madrid.

Phone: +34 91.597.8859 +34 91.597.8584 Fax:

THIS AIRWORTHINESS DIRECTIVE IS A TRANSLATION FROM THE SPANISH ORIGINAL ISSUE