

[Federal Register: July 16, 2003 (Volume 68, Number 136)]
[Rules and Regulations]
[Page 41906]
From the Federal Register Online via GPO Access [wais.access.gpo.gov]
[DOCID:fr16jy03-4]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2003-NE-23-AD; Amendment 39-13210; AD 2003-13-10]

RIN 2120-AA64

Airworthiness Directives; Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) Models 250-C30R/3, -C30R/3M, -C47B, and -C47M Turboshaft Engines; Correction

AGENCY: Federal Aviation Administration, DOT.

ACTION: Final rule; request for comments, correction.

SUMMARY: This document makes a correction to Airworthiness Directive (AD) 2003-13-10, applicable to Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) Models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines. AD 2003-13-10 was published in the Federal Register on June 30, 2003 (68 FR 38590). In the compliance section, paragraph (f) incorrectly references a compliance date of July 15, 2003 and should reference a compliance date of July 31, 2003. This document corrects that date. In all other respects, the original document remains the same.

EFFECTIVE DATE: July 15, 2003.

FOR FURTHER INFORMATION CONTACT: Khailaa Hosny, Aerospace Engineer, Chicago Aircraft Certification Office, FAA, 2300 East Devon Avenue, Des Plaines, IL 60018-4696; telephone (847) 294-7134; fax (847) 294-7834.

SUPPLEMENTARY INFORMATION: A final rule; request for comments airworthiness directive FR DOC. 03-15993, applicable to Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) Models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines, was published in the Federal Register on June 30, 2003 (68 FR 38590). The following correction is needed:

On page 38592, in the first column, under Initial Inspection heading, paragraph (f), fifth line, which reads "no later than July 15, 2003, in accordance * * *" is corrected to read "no later than July 31, 2003, in accordance * * *".

Issued in Burlington, MA, on July 10, 2003.
Francis A. Favara,
Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.
[FR Doc. 03-17950 Filed 7-15-03; 8:45 am]
BILLING CODE 4910-13-P

SUPERSEDED

[Federal Register: June 30, 2003 (Volume 68, Number 125)]
[Rules and Regulations]
[Page 38590-38592]
From the Federal Register Online via GPO Access [wais.access.gpo.gov]
[DOCID:fr30jn03-4]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. 2003-NE-23-AD; Amendment 39-13210; AD 2003-13-10]

RIN 2120-AA64

Airworthiness Directives; Rolls-Royce Corporation (Formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) Models 250-C30R/3, -C30R/3M, -C47B, and -C47M Turboshaft Engines

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule; request for comments.

SUMMARY: The FAA is adopting a new airworthiness directive (AD) for Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines. This AD requires initial and repetitive electrical signal inspections of the hydromechanical unit (HMU) Power Lever Angle (PLA) potentiometer. This AD is prompted by an investigation by the National Transportation Safety Board (NTSB), which revealed that a potential undetected failure of the PLA potentiometer electrical signal could cause uncommanded and sudden changes in engine power. The actions specified in this AD are intended to prevent uncommanded and sudden changes in engine power.

DATES: Effective July 15, 2003. The Director of the Federal Register approved the incorporation by reference of certain publications listed in the regulations as of July 15, 2003.

We must receive any comments on this AD by August 29, 2003.

ADDRESSES: Use one of the following addresses to submit comments on this AD:

- By mail: The Federal Aviation Administration (FAA), New England Region, Office of the Regional Counsel, Attention: Rules Docket No. 2003-NE-23-AD, 12 New England Executive Park, Burlington, MA 01803-5299.
- By fax: (781) 238-7055.
- By e-mail: 9-ane-adcomment@faa.gov

You may get the service information referenced in this AD from Rolls-Royce Corporation, P.O. Box 420, Indianapolis, IN 46206-0420; telephone (317) 230-6400; fax (317) 230-4243.

You may examine the AD docket at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA. You may examine the service information at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the Office of the Federal Register, 800 North Capitol Street, NW., suite 700, Washington, DC.

FOR FURTHER INFORMATION CONTACT: Khailaa Hosny, Aerospace Engineer, Chicago Aircraft Certification Office, FAA, 2300 East Devon Avenue, Des Plaines, IL 60018-4696; telephone (847) 294-7134; fax (847) 294-7834.

SUPPLEMENTARY INFORMATION: This AD applies to Rolls-Royce Corporation models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines. This AD requires initial and repetitive electrical signal inspections of the HMU PLA potentiometer. This AD is prompted by an investigation by the NTSB into uncommanded and sudden changes in engine power on a Bell 407 helicopter on March 27, 2003. The NTSB investigation revealed that a potential undetected failure of the PLA potentiometer electrical signal, provided by the HMU of the full-authority digital electronic control (FADEC) system, could cause uncommanded and sudden changes in engine power. The actions specified in this AD are intended to prevent uncommanded and sudden changes in engine power.

Relevant Service Information

We have reviewed and approved the technical contents of section 2.B. of the Accomplishment Instructions of Rolls-Royce Corporation combined Service Bulletin (SB) CEB A-73-3103 (250-C30 engines) and CEB A-73-6030 (250-C47 engines), Revision 3, dated June 5, 2003, that describes procedures for inspecting the PLA potentiometer signal.

Differences Between This Proposed AD and the Manufacturer's Service Information

Although the combined SB CEB A-73-3103 (250-C30 engines) and CEB A-73-6030 (250-C47 engines), Revision 3, dated June 5, 2003, also includes 250-C40 engines, as CEB A-73-5021, the 250-C40 engine model is not affected by this AD because it is used in twin engine applications.

FAA's Determination and Requirements of This AD

The unsafe condition described previously is likely to exist or develop on other Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines of the same type design. Therefore, we are issuing this AD to prevent uncommanded and sudden changes in engine power. This AD requires an initial electrical signal inspection of the HMU PLA potentiometer within 50 flight hours after the effective date of this AD, but no later than July 15, 2003, and thereafter, repetitive inspections every 300 flight hours. You must do these inspections in accordance with the service information described previously.

FAA's Determination of the Effective Date

Since an unsafe condition exists that requires the immediate adoption of this AD, we have found that notice and opportunity for prior public comment are impracticable, and that good cause exists for making this amendment effective in less than 30 days.

Changes to 14 CFR Part 39—Effect on the AD

On July 10, 2002, we issued a new version of 14 CFR part 39 (67 FR 47997, July 22, 2002), which governs our AD system. This regulation now includes material that relates to special flight permits, alternative methods of compliance, and altered products. This material previously was included in each individual AD. Since this material is included in 14 CFR part 39, we will not include it in future AD actions.

Comments Invited

This AD is a final rule that involves requirements affecting flight safety and was not preceded by notice and an opportunity for public comment; however, we invite you to submit any written relevant data, views, or arguments regarding this AD. Send your comments to an address listed under ADDRESSES. Include "AD Docket No. 2003-NE-23-AD" in the subject line of your comments. If you want us to acknowledge receipt of your mailed comments, send us a self-addressed, stamped postcard with the docket number written on it; we will date-stamp your postcard and mail it back to you. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the rule that might suggest a need to modify it. If a person contacts us through a nonwritten communication, and that contact relates to a substantive part of this AD, we will summarize the contact and place the summary in the docket. We will consider all comments received by the closing date and may amend the AD in light of those comments.

We are reviewing the writing style we currently use in regulatory documents. We are interested in your comments on whether the style of this document is clear, and your suggestions to improve the clarity of our communications with you. You may get more information about plain language at <http://www.plainlanguage.gov>.

Regulatory Findings

We have determined that this AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the regulation:

1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a summary of the costs to comply with this AD and placed it in the AD Docket. You may get a copy of this summary by sending a request to us at the address listed under ADDRESSES. Include "AD Docket No. 2003-NE-23-AD" in your request.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the Federal Aviation Administration amends part 39 of the Federal Aviation Regulations (14 CFR part 39) as follows:

PART 39–AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

SUPERSEDED

AIRWORTHINESS DIRECTIVE



Aircraft Certification Service
Washington, DC

U.S. Department
of Transportation
**Federal Aviation
Administration**

We post ADs on the internet at "www.faa.gov"

The following Airworthiness Directive issued by the Federal Aviation Administration in accordance with the provisions of Title 14 of the Code of Federal Regulations (14 CFR) part 39, applies to an aircraft model of which our records indicate you may be the registered owner. Airworthiness Directives affect aviation safety and are regulations which require immediate attention. You are cautioned that no person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of the Airworthiness Directive (reference 14 CFR part 39, subpart 39.3).

CORRECTION: [*Federal Register: July 16, 2003 (Volume 68, Number 136); Page 41906; www.access.gpo.gov/su_docs/aces/aces140.html*]

2003-13-10 Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison): Amendment 39-13210. Docket No. 2003-NE-23-AD.

Effective Date

- (a) This airworthiness directive (AD) becomes effective July 15, 2003.

Affected ADs

- (b) None.

Applicability

(c) This AD is applicable to Rolls-Royce Corporation (formerly Allison Engine Company, Allison Gas Turbine Division, and Detroit Diesel Allison) models 250-C30R/3, -C30R/3M, -C47B, and -C47M turboshaft engines. These engines are installed on, but not limited to, Bell OH-58D, Bell Helicopter Textron 407, Boeing AH/MH-6M, and MD Helicopters Inc. 600N helicopters.

Unsafe Condition

(d) This AD was prompted by an investigation by the National Transportation Safety Board that revealed that a potential undetected failure of the Power Lever Angle (PLA) potentiometer electrical signal could cause uncommanded and sudden changes in engine power. The actions specified in this AD are intended to prevent uncommanded and sudden changes in engine power.

Compliance

- (e) Compliance with this AD is required as indicated, unless already done.

Initial Inspection

(f) Perform an initial electrical signal inspection of the hydromechanical unit (HMU) PLA potentiometer, within 50 flight hours after the effective date of this AD, but no later than July 31, 2003, in accordance with paragraph 2.B. of the Accomplishment Instructions of Rolls-Royce Corporation combined service bulletin (SB) No. CEB A-73-3103 (250-C30 engines), or CEB A-73-6030 (250-C47 engines), Revision 3, dated June 5, 2003.

(g) Replace the HMU before further flight if the electrical signal inspection result is unacceptable.

Repetitive Inspections

(h) Thereafter, perform repetitive electrical signal inspections of the HMU PLA potentiometer within 300 flight hours of the previous inspection, in accordance with section 2.B. of the Accomplishment Instructions of Rolls-Royce Corporation combined SB No. CEB A-73-3103 (250-C30 engines), or CEB A-73-6030 (250-C47 engines), Revision 3, dated June 5, 2003.

(i) Replace the HMU before further flight if the electrical signal inspection is unacceptable.

Alternative Methods of Compliance

(j) Alternative methods of compliance must be requested in accordance with 14 CFR part 39.19, and must be approved by the Manager, Chicago Aircraft Certification Office, FAA.

Material Incorporated by Reference

(k) The inspections in this AD must be done in accordance with section 2.B. of the Accomplishment Instructions of Rolls-Royce Corporation combined Service Bulletin (SB) CEB A-73-3103 (250-C30 engines) and CEB A-73-6030 (250-C47 engines), Revision 3, dated June 5, 2003. The Director of the Federal Register approved the incorporation by reference of this document in accordance with 5 U.S.C. 552(a) and 1 CFR part 51. You may get a copy from Rolls-Royce Corporation, P.O. Box 420, Indianapolis, IN 46206-0420; telephone (317) 230-6400; fax (317) 230-4243. You may review copies at the FAA, New England Region, Office of the Regional Counsel, 12 New England Executive Park, Burlington, MA; or at the Office of the Federal Register, 800 North Capitol Street, NW, suite 700, Washington, DC.

Related Information

(l) None.

Issued in Burlington, Massachusetts, on June 19, 2003.

Robert G. Mann,
Acting Manager, Engine and Propeller Directorate, Aircraft Certification Service.

[FR Doc. 03-15993 Filed 6-27-03; 8:45 am]

BILLING CODE 4910-13-P