



## AGÊNCIA NACIONAL DE AVIAÇÃO CIVIL – BRAZIL

### BRAZILIAN AIRWORTHINESS DIRECTIVE

**AD No.: 2007-04-01R1**

**Effective Date: 21 Dec. 2007**

The following Brazilian Airworthiness Directive (AD), issued by the Agência Nacional de Aviação Civil (ANAC) in accordance with provisions of Chapter IV, Title III of Código Brasileiro de Aeronáutica - Law No. 7,565 dated 19 December 1986 - and Regulamento Brasileiro de Homologação Aeronáutica (RBHA) 39, applies to all aircraft registered in the Registro Aeronáutico Brasileiro. No person may operate an aircraft to which this AD applies, unless it has previously complied with the requirements established herein.

#### **AD No. 2007-04-01R1 - EMBRAER - Amendment 39-1221.**

#### **APPLICABILITY:**

This Airworthiness Directive is applicable to all Embraer ERJ-170 aircraft models in operation.

#### **CANCELLATION / REVISION:**

This AD cancels and supersedes the AD No. 2007-04-01 original issue – Amdt 39-1180, dated 10 May 2007, and is being issued to reduce the accomplishment time and to correct the affected part numbers (P/N).

#### **REASON:**

A few hydraulic system tube clamps located inside the wing fuel tanks were found damaged. Further analysis has shown that damage to multiple clamps may cause sparks inside the tanks, which in turn may lead to ignition of flammable vapors inside the fuel tanks.

Since this condition affects flight safety, a corrective action is required. Thus, sufficient reason exists to request compliance with this AD in the indicated time limit.

#### **REQUIRED ACTION:**

Replacement of the hydraulic system tubes attachment clamps located inside the wing fuel tanks by other ones with a new P/N.

#### **COMPLIANCE:**

Required as indicated below, unless already accomplished.

Within the next 8000 flight hours after 10 May 2007, the effective date of the original issue of this AD, replace clamps P/N PE27019RF4E and PE27019RF8E which attach the hydraulic tubes inside the wing fuel tanks by new ones bearing P/N PE27019FS4E and PE27019FS8E, respectively.

The detailed instructions and procedures to accomplish this AD are described in the Embraer Service Bulletin No. 170-29-0006 original issue, or further revisions approved by the ANAC.

Record compliance with this AD in the applicable maintenance log book.

#### **CONTACT:**

For additional technical information, contact:

National Civil Aviation Agency (ANAC)

Aeronautical Products Certification Branch (GGCP)

Av. Cassiano Ricardo, 521, Bloco B, 2º andar, Parque Residencial Aquarius

Fax: 55 (12) 3797-2330

12246-870 – São José dos Campos - SP, BRAZIL.

E-mail: pac@anac.gov.br

For acquisition, contact:

National Civil Aviation Agency (ANAC)  
Publications Branch  
R. Santa Luzia, 651, 2º Mezanino, Centro  
Fax: 55 (21) 3814-6791  
20030-040 – Rio de Janeiro - RJ, BRAZIL.  
E-mail: publicacoes@anac.gov.br

**APPROVAL:**

CLÁUDIO PASSOS SIMÃO  
General Manager  
GGCP

ALLEMANDER J. PEREIRA FILHO  
Director  
ANAC

**NOTE:** Original in Portuguese language signed and available in the files of the Aeronautical Products Certification Branch (GGCP) of the National Civil Aviation Agency (ANAC).