



AGÊNCIA NACIONAL DE AVIAÇÃO CIVIL - BRAZIL

BRAZILIAN AIRWORTHINESS DIRECTIVE

AD No.: 2012-08-03R1

Effective Date: 28 Jan. 2026

The following Brazilian Airworthiness Directive (AD), issued by the Agência Nacional de Aviação Civil (ANAC) in accordance with provisions of Chapter IV, Title III of Código Brasileiro de Aeronáutica - Law No. 7,565 dated 19 December 1986 - and Regulamento Brasileiro da Aviação Civil (RBAC) 39, applies to all aircraft registered in the Registro Aeronáutico Brasileiro. No person may operate an aircraft to which this AD applies, unless it has previously complied with the requirements established herein.

AD No. 2012-08-03R1 - EMBRAER / 39-1598.

APPLICABILITY:

This Airworthiness Directive applies to EMBRAER S.A. model ERJ 190-100 ECJ, ERJ 190-100 STD, ERJ 190-100 LR, ERJ 190-100 IGW*, ERJ 190-100 SR, ERJ 190-200 STD, ERJ 190-200 LR, and ERJ 190-200 IGW airplanes; as identified in Embraer Service Bulletin (SB) 190-52-0038, Revision 01 and 190LIN-52-0020, both dated August 01, 2011, as applicable.

*Except airplanes post-mod SB190-25-0270 (freighter configuration)

CANCELLATION / REVISION:

This AD cancels and supersedes the AD No. 2012-08-03/ 39-1360, dated September 05, 2012, and is being issued to clarify that this AD does not apply to airplanes model ERJ 190-100 IGW post-mod SB190-25-0270 (*freighter configuration*).

REASON:

This AD was prompted by reports of cockpit door falling off the hinges when it is being opened or closed. If not corrected, this condition may cause injury to the occupants.

Since this condition may occur in other airplanes of the same type and affects flight safety, a corrective action is required. Thus, sufficient reason exists to request compliance with this AD in the indicated time limit.

REQUIRED ACTION:

Replacement of cockpit door passive lock striker, quick-release pin and hinges.

COMPLIANCE:

Required as indicated below, unless already accomplished.

Replacement of cockpit door passive lock striker, quick-release pin and hinges

(a) Within 1,500 flight hours after September 05, 2012, the effective date of AD 2012-08-03, original revision, do the actions required by paragraphs **(a)(1)** and **(a)(2)** of this AD.

(1) Replace the cockpit door passive lock striker and quick-release pin according to Part I of the Accomplishment Instructions of Embraer SB 190-52-0038, Revision 01, or 190LIN-52-0020, both dated August 01, 2011, as applicable, or further revision approved by the ANAC; and

(2) Replace the cockpit door upper and lower hinges in accordance with Part III of the Accomplishment Instructions of Embraer SB 190-52-0038, Revision 01, or 190LIN-52-0020, both dated August 01, 2011, as applicable, or further revision approved by the ANAC.

Material Incorporated by Reference

(b) You must use Embraer SB 190-52-0038, Revision 01, or 190LIN-52-0020, both dated August 01, 2011, as applicable, or further revision approved by the ANAC, to do the actions required by this AD, unless the AD specifies otherwise

Credit for Previous Actions

(c) This paragraph provides credit for the actions required by paragraph **(a)(1)** of this AD, if those actions were performed before the effective date of this AD, using Embraer SB 190-52-0038, dated February 10, 2011.

Alternative Means of Compliance (AMOC)

(d) A different method or a different compliance time, with the requirements of this AD, may be used if approved by the Continuing Airworthiness Technical Manager (GTAC).

Record compliance with this AD in the applicable maintenance log book.

CONTACT:

For additional technical information, contact:

National Civil Aviation Agency (ANAC)
Continuing Airworthiness Technical Branch (GTAC)
Rua Doutor Orlando Feirabend Filho, nº 230
Centro Empresarial Aquárius – Torre B – Floors 14 and 15
Parque Residencial Aquárius
CEP 12246-190 – São José dos Campos – SP
E-mail: pac@anac.gov.br

APPROVAL:

LUCIANA FERREIRA VIEIRA
Head of Airworthiness Department
ANAC

NOTA: Original in Portuguese language signed and available in the files of the Continuing Airworthiness Technical Branch (GTAC) of the National Civil Aviation Agency (ANAC).