

**Datum der Bekanntgabe: 20.11.1997**

**Muster:** Dornier  
Dornier 328

**AD der ausländischen Behörde:**  
- keine -

**Geräte-Nr.:**  
2534

**Technische Mitteilungen des Herstellers:**  
Dornier 328 Service Bulletin Nr. 328-21-218 vom 02.07.1997

**Betroffenes Luftfahrtgerät:**

Dornier  
Dornier 328

- **Baureihen:** Dornier 328-100

- **Werk-Nrn.:** 3005 bis 3089

**Betrifft:**

Klimaanlage, Lüfter, Ansteuerrelais  
- ggf. Überhitzung des Relais

**Maßnahmen:**

Wechsel des Relais.

**Fristen:**

Durchführung bis spätestens 31.12.1997

Durch die vorgenannten Mängel ist die Lufttüchtigkeit des Luftfahrtgerätes derart beeinträchtigt, daß es nach Ablauf der genannten Fristen nur in Betrieb genommen werden darf, wenn die angeordneten Maßnahmen ordnungsgemäß durchgeführt worden sind. Im Interesse der Sicherheit des Luftverkehrs, das in diesem Fall das Interesse des Adressaten am Aufschub der angeordneten Maßnahmen überwiegt, ist es erforderlich die sofortige Vollziehung dieser LTA anzuordnen.

**Rechtsbehelfsbelehrung:**

Gegen diese Verfügung kann innerhalb eines Monats nach Bekanntgabe Widerspruch eingelegt werden. Der Widerspruch ist schriftlich oder zur Niederschrift beim Luftfahrt-Bundesamt, Lilienthalplatz 6, 38108 Braunschweig einzulegen.

\* \* \*



**Airworthiness  
Directive  
97-323**

**Luffahrt-Bundesamt**  
Airworthiness Directive Section  
Lilienthalplatz 6  
38108 Braunschweig  
Federal Republic of Germany

**Dornier**

Effective Date: November 20, 1997

**Affected:**

Kind of aeronautical product:	Aircraft
Manufacturer:	Dornier, Wessling, Germany
Type:	Dornier 328
Models affected:	Dornier 328-100
Serial numbers affected:	3005 up to 3089
German Type Certificate No.:	2534

---

**Subject:**

Air Conditioning - Exchange of re-circulation fan relay

**Reason:**

The existing relay P/N DON405M520U5NL is exposed to high electrical loads which, due to the relay design, has resulted in overheating beyond the permissible range in service.

**Action:**

Exchange of relay 32HB and 36HB on the relay panel 22VE with a stronger relay P/N 2504MY1.

**Compliance:**

Action must be performed prior December 31, 1997.

**Technical publication of the manufacturer:**

Dornier 328 Service Bulletin No. 328-21-218 dated July 02, 1997 which becomes herewith part of this AD and must be obtained from Messrs.:

Fairchild /Dornier  
P.O. Box 1103

D-82230 Wessling  
Federal Republik of Germany

**Accomplishment and log book entry:**

Action to be accomplished by an approved service station and to be checked and entered in the log book by a licensed inspector.