

## Airworthiness Directive

**AD No.:** 2023-0199

**Issued:** 17 November 2023

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

### Design Approval Holder's Name:

AIRBUS S.A.S.

### Type/Model designation(s):

A330 aeroplanes

**Effective Date:** 01 December 2023

**TCDS Number(s):** EASA.A.004

**Foreign AD:** Not applicable

**Supersedure:** This AD supersedes EASA AD 2020-0054 dated 11 March 2020 and EASA AD 2021-0248R1 dated 12 October 2022.

## ATA 05 – Time Limits / Maintenance Checks – Airworthiness Limitations Section Part 3 – Certification Maintenance Requirements – Amendment

### Manufacturer(s):

Airbus, formerly Airbus Industrie

### Applicability:

Airbus A330-201, A330-202, A330-203, A330-223, A330-223F, A330-243, A330-243F, A330-301, A330-302, A330-303, A330-321, A330-322, A330-323, A330-341, A330-342, A330-343, A330-841 and A330-941 aeroplanes, all manufacturer serial numbers.

### Definitions:

For the purpose of this AD, the following definitions apply:

**The ALS:** Airbus A330 Airworthiness Limitations Section (ALS) Part 3 Revision 08.

**The AMP:** The Aircraft Maintenance Programme (AMP) contains the tasks on the basis of which the scheduled maintenance is conducted to ensure the continuing airworthiness of each operated aeroplane. For aeroplanes operated under EU regulation the operator or the owner ensures compliance with the AMP as stipulated in Commission Regulation (EU) [1321/2014](#).

**New and/or more restrictive tasks:** This includes all tasks that are new and all tasks for which a threshold or interval was reduced, which were introduced into the ALS (as defined in this AD) since the previous ALS revision that is currently incorporated in the AMP.

**Reason:**

The airworthiness limitations instructions for the Airbus A330 aeroplanes, which are approved by EASA, are currently defined and published in the A330 ALS document. These instructions have been identified as mandatory for continued airworthiness. The airworthiness limitations applicable to the Certification Maintenance Requirements are specified in ALS Part 3.

Failure to accomplish these instructions could result in an unsafe condition.

Previously, EASA issued AD 2021-0248, later revised, to require accomplishment of all maintenance tasks as described in ALS Part 3 at Revision 07; AD 2013-0251 (for A330-200 and A330-300 family aeroplanes, and A340 aeroplanes), later corrected, and AD 2020-0054 (for A330-941 aeroplanes) to require repetitive operational tests of the hydraulic locking function of the spoiler servo-control (SSC) installed on the blue and yellow hydraulic circuits, and, depending on test results, replacement of the SSC.

Since those ADs were issued, Airbus published the ALS, to introduce new and/or more restrictive tasks, including the repetitive operational tests as required by EASA AD 2013-0251 and AD 2020-0054.

For the reason described above, this AD takes over the requirements of EASA AD 2013-0251 for A330 aeroplanes, retains the requirements of EASA AD 2021-0248R1 and AD 2020-0054, which are superseded, and requires accomplishment of the actions specified in the ALS.

In addition, EASA AD 2023-0200 has been issued for A340 aeroplanes, taking over the requirements of EASA AD 2013-0251, which, consequently, became obsolete and is cancelled.

**Required Action(s) and Compliance Time(s):**

Required as indicated, unless accomplished previously:

**Maintenance Tasks:**

- (1) From the effective date of this AD, within the thresholds and intervals (see Note 1 of this AD), accomplish all applicable maintenance tasks, as specified in the ALS, as applicable to aeroplane model and depending on aeroplane configuration.

Note 1: For the purpose of this AD, the thresholds and intervals, as defined in the 'Compliance Time' pages of the ALS, include specific compliance times for certain tasks.

**Corrective Action(s):**

- (2) In case of finding discrepancies during accomplishment of any task as required by paragraph (1) of this AD, before next flight, accomplish the applicable corrective action(s) in accordance with the applicable Airbus maintenance documentation. If a detected discrepancy cannot be corrected by using existing Airbus instructions, before next flight, contact Airbus for approved instructions and accomplish those instructions accordingly.



**AMP Revision:**

- (3) Within 12 months after the effective date of this AD, revise the AMP by incorporating the tasks and associated thresholds and intervals described in the ALS, as applicable to aeroplane model and depending on aeroplane configuration.

**Credit:**

- (4) If, before the effective date of this AD, the AMP has been revised to incorporate the maintenance tasks as specified in a previous ALS revision, that action ensures the continued accomplishment of those tasks.

Consequently, for an aeroplane to which that AMP applies, it is acceptable to accomplish the new and/or more restrictive tasks, as defined in this AD, as applicable to aeroplane model and depending on aeroplane configuration, within the compliance times (see Note 1 of this AD) as specified in the ALS to comply with paragraph (1) of this AD.

For that AMP, it is acceptable to incorporate the new and/or more restrictive tasks, as specified in the ALS, as applicable to aeroplane model and depending on aeroplane configuration, into the AMP to comply with paragraph (3) of this AD.

**Recording AD Compliance:**

- (5) When the AMP of an aeroplane has been revised as required by paragraph (3) or (4) of this AD, as applicable, that action ensures continued accomplishment of the tasks as required by paragraphs (1) and (2) of this AD for that aeroplane. Consequently, after revising the AMP, as required by paragraph (3) or (4) of this AD, as applicable, it is not necessary that accomplishment of individual action is recorded for demonstration of AD compliance on a continued basis.

**Ref. Publications:**

Airbus A330 ALS Part 3 Revision 08 dated 02 October 2023.

The use of later approved variations or revisions of this document is acceptable for compliance with the requirements of this AD.

**Remarks:**

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 18 October 2023 as PAD 23-116 for consultation until 15 November 2023. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (zipped) file attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than



those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.

5. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – 1IAL (Airworthiness Office), E-mail: [airworthiness.A330-A340@airbus.com](mailto:airworthiness.A330-A340@airbus.com).

Superseded

