



Notification of a Proposal to issue an Airworthiness Directive

PAD No.: 19-135

Issued: 23 July 2019

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below.

All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

Design Approval Holder's Name:

DIAMOND AIRCRAFT INDUSTRIES GmbH

Type/Model designation(s):

DA 42 aeroplanes

Effective Date: [TBD - standard: 14 days after AD issue date]

TCDS Number(s): EASA.A.005 and EASA.A.513

Foreign AD: Not applicable

Supersedure: None

ATA 28 – Fuel – Fuel Tank Connection Hoses – Replacement

Manufacturer(s):

Diamond Aircraft Industries GmbH (Austria), Diamond Aircraft Industries Inc. (Canada)

Applicability:

DA 42 and DA 42 M aeroplanes (including those certified in the Restricted category), all manufacturer serial numbers (MSN); and

DA 42 NG and DA 42 M-NG aeroplanes (including those certified in the Restricted category), all MSN that have been converted from DA 42 and DA 42 M aeroplanes via Optional Service Bulletin (OSB) 42-068 or OSB 42-081, as applicable.

Definitions:

For the purpose of this AD, the following definitions apply:

The applicable MSB: Diamond Aircraft Industries (DAI) Mandatory Service Bulletin (MSB) 42-138 and MSB 42NG-080, which includes Work Instruction WI-MSB 42-138 and WI-MSB 42NG-080 (published as a single document).



Affected part: Fuel tank connection hoses, having Part Number (P/N) D4D-2817-10-70, as installed on the affected MSN as identified in the applicable MSB, and those as identified by invoice date, tracking number, work order and invoice number in the applicable MSB.

Serviceable part: Any fuel tank connection hose having P/N D4D-2817-10-70 that is not an affected part, and fuel tank connection hoses having P/N D4D-2817-10-70_01.

Reason:

Reports were received of dissolved fuel tank connections hoses. Rubber parts were found within the fuel tank. The investigation results showed that the affected parts are limited to 2 isolated batches, some of which were installed on the production line. Other affected parts have been supplied as spare for in-service replacement.

This condition, if not corrected, could lead to restricted fuel flow from the tank, possibly resulting in fuel starvation and consequent reduced control of the aeroplane.

To address this potential unsafe condition, DAI issued the applicable MSB, providing instructions to identify and replace the affected parts. The applicable MSB identifies the MSN of the aeroplanes on which affected parts were installed during aeroplane production. The applicable MSB also indicates that any other aeroplane may be affected, if an affected part supplied as spare was installed.

For the reason described above, this AD requires removal from service of the affected parts.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Replacement:

- (1) Within 100 flight hours or 4 months, whichever occurs first after the effective date of this AD, replace each affected part with a serviceable part in accordance with the instructions of the applicable MSB.

Parts Installation:

- (2) From the effective date of this AD, do not install an affected part on any aeroplane.

Ref. Publications:

DAI MSB 42-138 and MSB 42NG-080 (published as a single document) original issue dated 01 July 2019.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. This Proposed AD will be closed for consultation on 20 August 2019.
2. Enquiries regarding this PAD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.



3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#).
4. For any question concerning the technical content of the requirements in this PAD, please contact: Diamond Aircraft Industries GmbH, Austria, Telephone: +43 2622 26700, Fax: +43 2622 26780, E-mail: airworthiness@diamond-air.at.

