



Notification of a Proposal to issue an Airworthiness Directive

PAD No.: 19-209

Issued: 28 November 2019

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below.

All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A318, A319, A320 and A321 aeroplanes

Effective Date: [TBD - standard: 14 days after AD issue date]

TCDS Number(s): EASA.A.064

Foreign AD: Not applicable

Supersedure: None

ATA 53 – Fuselage – Frame Foot Coupling at Frame 43 – Inspection / Repair

Manufacturer(s):

Airbus, formerly Airbus Industrie.

Applicability:

Airbus A318-111, A318-112, A318-121, A318-122, A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-131, A321-211, A321-212, A321-213, A321-231 and A321-232 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 153126 or mod 153742 was embodied in production.

Definitions:

For the purpose of this AD, the following definitions apply:

The inspection SB: Airbus Service Bulletin (SB) A320-53-1269 Revision (Rev.) 02.

The modification SB: Airbus SB A320-53-1270 Rev. 02.

Affected area: Fastener holes of frame (FR) feet couplings on both left-hand (LH) side and right-hand (RH) sides in area of fuselage FR43.



Reason:

During scheduled maintenance on the first rivet hole of the affected area, cracks were detected on both LH and RH sides.

This condition, if not detected and corrected, could affect the structural integrity of the aeroplane.

To address this unsafe condition, Airbus developed mod 153126 and mod 153742 for implementation on the production line. For aeroplanes in service, Airbus issued SB A320-53-1269, later revised, providing inspection and repair instructions (RI) R533-70232 and RI R533-70233, SB A320-53-1270, later revised, providing modification instructions.

For the reasons described above, this AD requires a one-time special detailed inspection (SDI) of each affected area and, depending of findings, repair or modification.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection(s):

- (1) Within the compliance time as defined in Table 1 of this AD, as applicable, accomplish an SDI of each affected area in accordance with the instructions of the inspection SB.

Table 1 – SDI (see Note 1 of this AD)

Time Accumulated	Compliance Time	
Less than 40 000 flight cycles (FC) and less than 80 000 flight hours (FH)	A or B , whichever occurs later	
	A	Before exceeding 24 000 FC or 48 000 FH, whichever occurs first since aeroplane first flight
	B	Within 5 500 FC or 11 000 FH, whichever occurs first after the effective date of this AD, without exceeding 42 000 FC or 84 000 FH since aeroplane first flight
40 000 FC or 80 000 FH, or more	Within 2 000 FC or 4 000 FH, whichever occurs first after the effective date of this AD	

Note 1: Unless indicated otherwise, the FC and FH specified in Table 1 of this AD are those accumulated, on the effective date of this AD, by the aeroplane since first flight.

Corrective Action(s):

- (2) If, during the SDI as required by paragraph (1) of this AD, any crack is detected in an affected area, before next flight, repair that affected area in accordance with the instructions of the inspection SB.
- (3) If, during the SDI as required by paragraph (1) of this AD, **no** crack is detected in an affected area, before next flight, modify that affected area in accordance with the instructions of the modification SB.



Credit:

- (4) Inspection and repair, as applicable, of an affected area on an aeroplane, accomplished before the effective date of this AD in accordance with the instructions of the inspection SB at original issue or Rev. 1, is acceptable to comply with the requirements of paragraphs (1) and (2) of this AD for that aeroplane for that affected area.
- (5) Modification of an affected area on an aeroplane, accomplished before the effective date of this AD in accordance with the instructions of SB A320-53-1270 at original issue or Rev. 02, is acceptable to comply with the requirement of paragraphs (1) and (3) of this AD for that aeroplane for that affected area.
- (6) Repair of an affected area on an aeroplane, accomplished before the effective date of this AD in accordance with the instructions of RI R533-70232 is acceptable to comply with the requirements of paragraph (1) and (2) of this AD for that aeroplane for that affected area.
- (7) Repair of an affected area on an aeroplane, accomplished before the effective date of this AD in accordance with the instructions of RI R533-70233, flowchart 1 or 2, is acceptable to comply with the requirements of paragraph (1) and (2) of this AD for that aeroplane for that affected area.

Additional Work:

- (8) For an aeroplane on which an affected area was modified before the effective date of this AD, in accordance with the instructions of the modification SB at Rev. 1, within the compliance time as defined in Table 1 of this AD, as applicable, accomplish the additional work, as applicable for that affected area, in accordance with the instructions of the modification SB or contact Airbus for approved instructions and apply those instructions accordingly.

Note 2: For an aeroplane on which an affected area was repaired before the effective date of this AD, in accordance with the instructions of RI R533-70233, flowchart 3, in accordance with the applicable post repair instructions, within 15 000 FC after accomplishment of that repair, repair that affected area in accordance with the instructions of RI R533-70232.

Ref. Publications:

Airbus SB A320-53-1269 original issue dated 17 January 2013, or Revision 01 dated 10 July 2013, or Revision 02 dated 07 February 2019.

Airbus SB A320-53-1270 original issue dated 17 January 2013, or Revision 01 dated 27 September 2013, or Revision 02 dated 11 April 2014.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

- 1. This Proposed AD will be closed for consultation on 26 December 2019.
- 2. Enquiries regarding this PAD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.



3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#).
4. For any question concerning the technical content of the requirements in this PAD, please contact: AIRBUS – Airworthiness Office – EIAS; Fax +33 5 61 93 44 51;
E-mail: account.airworth-eas@airbus.com.

