



Notification of a Proposal to issue an Airworthiness Directive

PAD No.: 20-050

Issued: 12 March 2020

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below. All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A380 aeroplanes

Effective Date: [TBD - standard: 14 days after AD issue date]

TCDS Number(s): EASA.A.110

Foreign AD: Not applicable

Supersedure: None

ATA 54 – Nacelles / Pylons – Inboard Pylon Box at Rib 14 Fasteners – Inspection / Replacement

Manufacturer(s):

Airbus

Applicability:

Airbus A380-841, A380-842 and A380-861 aeroplanes, all manufacturer serial numbers, except those that have embodied Airbus modification 77372 in production.

Definitions:

The applicable SB: Airbus Service Bulletin (SB) A380-54-8067 (Engine Alliance GP7200 engines) or SB A380-54-8069 (Rolls-Royce Trent 900 engines), as applicable.

Affected fasteners: Fasteners, attaching the lateral panel to Rib 14 at the rear wing to inboard (engine #2 and #3) pylon attachments, installed at locations as indicated in the applicable SB.

Airbus date of manufacture: The date of transfer of title (ownership) of the aeroplane upon delivery by Airbus to the first operator.



Reason:

During the full scale fatigue test, cracks have been found in the cruciform recess of the head of some inboard (engine #2 and #3) pylon box fasteners, defined in this AD as the affected fasteners.

This condition, if not detected and corrected, could lead, under fatigue effects, to damage on the affected fasteners, possibly resulting in in-flight lateral panel detachment and consequent damage to, and reduced control of, the aeroplane.

To address this potential unsafe condition, Airbus issued the applicable SB to provide instructions to inspect the affected fasteners and the affected fastener holes.

For the reasons described above, this AD requires repetitive inspections of the affected fasteners and holes and, depending on findings, accomplishment of applicable corrective action(s).

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection(s):

- (1) Before exceeding 8 800 flight cycles (FC) since Airbus date of manufacture and, thereafter, at intervals not to exceed 8 800 FC, inspect the affected fasteners and holes in accordance with the instructions of the applicable SB.

Corrective Action(s):

- (2) Depending on findings during each inspection as required by paragraph (1) of this AD, before next flight, accomplish the applicable corrective action(s) and, thereafter, depending on findings, accomplish any applicable follow-on action(s) in accordance with the instructions (see Note 1 of this AD) of the applicable SB, or in accordance with approved instructions provided by Airbus, as applicable.

Note 1: Using Section 1.E, Table 1 and the Flowcharts (for initial and repeat inspection, respectively) as provided in the applicable SB is an acceptable method to determine which action is required and when.

Terminating Action:

- (3) None.

Ref. Publications:

Airbus SB A380-54-8067 original issue dated 24 September 2019.

Airbus SB A380-54-8069 original issue dated 24 September 2019.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. This Proposed AD will be closed for consultation on 09 April 2020.



2. Enquiries regarding this PAD should be referred to the EASA Programming and Continued Airworthiness Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#).
4. For any question concerning the technical content of the requirements in this PAD, please contact: Airbus – IIANA (Airworthiness Office), Telephone: +33 562 110 253, Fax: +33 562 110 307, E-mail: account.airworth-A380@airbus.com.

