



## Notification of a Proposal to issue an Airworthiness Directive

**PAD No.:** 21-062

**Issued:** 30 April 2021

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below. All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

**Design Approval Holder's Name:** ROLLS-ROYCE DEUTSCHLAND Ltd & Co KG  
**Type/Model designation(s):** RB211 Trent 900 engines

**Effective Date:** [TBD - standard: 14 days after AD issue date]

**TCDS Number(s):** EASA.E.012

**Foreign AD:** Not applicable

**Supersedure:** None

### ATA 73 – Engine Fuel & Control – Low Pressure Compressor Case Static P30 Air System – Modification

#### Manufacturer(s):

Rolls-Royce plc

#### Applicability:

RB211 Trent 970-84, Trent 972-84 and Trent 972E-84 engines, all serial numbers (ESN) up to 91566 inclusive, except ESN 91509.

These engines are known to be installed on, but not limited to, Airbus A380 aeroplanes.

#### Definitions:

For the purpose of this AD, the following definitions apply:

**Affected part:** Low pressure (LP) compressor case air tube assemblies, having Part Number (P/N) KH30025.

**The SB:** Rolls-Royce Alert Service Bulletin (SB) RB.211-73-AK278 Revision 1. The SB has an 'A' (Alert) in the number, but an earlier or later revision may not have that 'A'. This kind of change does not effectively alter the publication references.



**Groups:** Group 1 engines are those on which modification (mod) 73-J441 has been embodied in production (ESN 91477 and up), or SB RB.211-73-J441 has been embodied in service.

Group 2 engines are those in post-mod/SB 73-G165 (any revision) and pre-mod/SB 73-J441 configuration.

Group 3 engines are those in post-mod/SB 73-K278 configuration.

**Reason:**

Through introduction of production mod 73-J441 and issuance of SB RB.211-73-J441, Rolls-Royce introduced a flowing P30 air system, with the purpose of minimising the maintenance burden prompted by freezing events in the P30 sense line. However, since that mod/SB was introduced, occurrences have been reported of discrepancies between the software channel A and channel B P30 signals of engines with the flowing P30 air system installed. As a consequence of such an event, the Engine Electronic Controller could select an erroneous P30 value to control the engine.

This condition, if not corrected, could lead to thrust delivery deviating from thrust setting(s), possibly resulting in reduced control of the aeroplane.

To address this potential unsafe condition, Rolls-Royce issued SB RB.211-73-K278 (later revised), providing instructions to modify the P30 air system by replacing the affected part with an LP compressor case air tube assembly, having P/N KH97158, and installing blanking discs, having P/N LK65367.

For the reasons described above, this AD requires modification of the P30 air system. For Group 1 (after modification) and Group 3 engines, this AD prohibits (re)installation of an affected part. For Group 2 engines, this AD prohibits modification in accordance with the instructions of SB RB.211-73-J441.

**Required Action(s) and Compliance Time(s):**

Required as indicated, unless accomplished previously:

**Modification:**

- (1) For Group 1 engines: Within 11 months after the effective date of this AD, modify the P30 air system in accordance with the instructions of the SB.

**Credit:**

- (2) Modification of an engine, accomplished before the effective date of this AD in accordance with the instructions of Rolls-Royce SB RB.211-73-K278 at original issue, is an acceptable method to comply with the requirements of paragraph (1) of this AD for that engine.

**Parts Installation:**

- (3) Do not install an affected part on any engine, as required by paragraph (3.1) or (3.2) of this AD, as applicable.

(3.1) For Group 1 engines: After modification of the engine as required by paragraph (1) of this AD.

(3.2) For Group 3 engines: From the effective date of this AD.



**Modification Prohibition:**

- (4) For Group 2 engines: From the effective date of this AD, do not modify any engine in accordance with the instructions of SB RB.211-73-J441 (any revision).

**Ref. Publications:**

Rolls-Royce Trent 900 SB RB.211-73-K278 original issue dated 30 January 2019, or Alert SB RB.211-73-AK278 Revision 1 dated 14 April 2021.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Rolls-Royce Trent 900 SB RB.211-73-J441 original issue dated 09 May 2017, or Revision 1 dated 30 January 2019.

Rolls-Royce Trent 900 SB RB.211-73-G165 original issued dated 08 September 2009, or Revision 1 dated 19 April 2011, or Revision 2 dated 06 April 2016.

**Remarks:**

1. This Proposed AD will be closed for consultation on 14 May 2021.
2. Enquiries regarding this PAD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this PAD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
4. For any question concerning the technical content of the requirements in this PAD, please contact your designated Rolls-Royce representative, or download the publication from your Rolls-Royce Care account at <https://customers.rolls-royce.com>.

If you do not have a designated representative or Rolls-Royce Care account, please contact **Corporate Communications** at **Rolls-Royce plc**, P.O. Box 31, Derby, DE24 8BJ, United Kingdom Telephone +44 (0)1332 242424,

or send an email through <https://www.rolls-royce.com/contact-us/civil-aerospace.aspx> identifying the correspondence as being related to **Airworthiness Directives**.

