



Notification of a Proposal to issue an Airworthiness Directive

PAD No.: 21-099

Issued: 09 July 2021

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below.

All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

Airbus aeroplanes (see Applicability)

Effective Date: [TBD - standard: 14 days after AD issue date]

TCDS Number(s): EASA.A.004, EASA.A.014, EASA.A.015, EASA.A.064 and EASA.A.172

Foreign AD: Not applicable

Supersedure: This AD supersedes EASA AD 2019-0085 dated 18 April 2019.

ATA 35 – Oxygen – Crew and Passenger Oxygen Cylinders – Inspection / Replacement

Manufacturer(s):

Airbus, formerly Airbus Industrie

Applicability:

Airbus A300, A300-600 and A310 aeroplanes, all certified models, all manufacturer serial numbers (MSN);

Airbus A300F4-608ST aeroplanes, all MSN;

Airbus A318, A319, A320 and A321 aeroplanes, all certified models, all MSN;

Airbus A330 aeroplanes, all certified models except A330-223F and A330-243F, all MSN; and

Airbus A340 aeroplanes, all certified models, all MSN.

Definitions:

For the purpose of this AD, the following definitions apply:

All certified models: This includes all models (of a type design) certified before the date of issuance of this AD.



Affected part: Oxygen cylinders, having Part Number (P/N) 89794077, P/N 89794015, or P/N 891511-14, except those that passed an inspection (marked with blue dot) in accordance with the instructions of the AOT or the SB.

Batch 1: Affected parts having a serial number (s/n) as listed in the Appendix 1 of the SB at original issue.

Batch 2: Affected parts having a s/n as listed in the Appendix 2 of the SB at Revision 03.

Serviceable part: Oxygen cylinders which are not an affected part.

The SB: SAFRAN (AVOX Systems, Inc.) Service Bulletin (SB) 10015804-35-01.

The AOT: Airbus Alert Operators Transmission (AOT) A35W014-19 (A300/A310), AOT A35L013-19 (A330/A340) and AOT A35N012-19 (A318 through A321), as applicable, which refer for accomplishment instructions to the SB.

Groups: Group 1 aeroplanes are those that have an affected part installed.
Group 2 aeroplanes are those that do not have an affected part installed.

Reason:

Several occurrences were reported of a cylinder and hand valve with oxygen leakage from the valve assembly vent hole. The technical investigation identified that an internal part (guide) was not assembled onto the stem. It was determined that a batch of oxygen cylinders produced in 2018 is potentially affected by this manufacturing discrepancy.

This condition, if not detected and corrected, could lead to reducing the available oxygen capacity of the aeroplane, possibly resulting in injury to aeroplane occupants following a depressurization event. In addition, there is a possibility of ignition/fire in-flight in case of an open hand valve assembly failure, depending on installation zone, or ignition/fire during system ground testing following (re)installation on an aeroplane, possibly resulting in injury to aeroplane occupants or maintenance staff, respectively.

To address this potential unsafe condition, Airbus issued the AOT (original issue) to provide inspection instructions and EASA issued AD 2019-0085 to require a one-time inspection of each affected part (Batch 1) and, depending on findings, replacement with a serviceable part. That AD also prohibited (re)installation of an affected part on an aeroplane.

Since that AD was issued, additional parts (Batch 2) have been identified by SAFRAN (AVOX Systems, Inc.) as affected by the same potential unsafe condition. The AOT and the SB have been revised accordingly.

For the reason described above, this AD retains the requirements of EASA AD 2019-0085, which is superseded, and expands the list of affected parts.



Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Inspection(s):

- (1) For Group 1 aeroplanes: Within the compliance time specified in Table 1 of this AD, inspect the hand valve of each affected part in accordance with the instructions of the AOT and the SB.

Table 1 – Affected Part Inspection

Batch	Compliance Time
1	Before any maintenance action on an affected part, or within 60 days, whichever occurs first after 02 May 2019 [the effective date of EASA AD 2019-0085]
2	Before any maintenance action on an affected part, or within 60 days, whichever occurs first after the effective date of this AD

Corrective Action(s):

- (2) If, during the inspection as required by paragraph (1) of this AD, an affected part does not meet the criteria as defined in the AOT and the SB, before next flight, or before (re)installation, as applicable, empty that cylinder and replace it with a serviceable part, as defined in this AD, in accordance with the instructions of the SB.

Alternative Method:

- (3) Replacement on an aeroplane of all affected parts with serviceable parts, as defined in this AD, is an acceptable alternative method to comply with the requirements of paragraph (1) of this AD for that aeroplane, provided this is accomplished within 60 days after 02 May 2019 [the effective date of EASA AD 2019-0085 for Batch 1 affected parts] or within 60 days after the effective date of this AD for Batch 2 affected parts, and that, until that replacement, no maintenance action is accomplished on any affected part installed on that aeroplane.

Parts Installation:

- (4) For Group 1 and Group 2 aeroplanes: From the effective date of this AD, do not install an affected part on any aeroplane.

Ref. Publications:

Airbus AOT A35W014-19 original issue dated 06 March 2019, or Revision 01 dated 22 June 2021.

Airbus AOT A35L013-19 original issue dated 06 March 2019, or Revision 01 dated 22 June 2021.

Airbus AOT A35N012-19 original issue dated 06 March 2019, or Revision 01 dated 22 June 2021.

SAFRAN / AVOX Systems, Inc. SB 10015804-35-01 original issue dated 06 March 2019, Revision 01 dated 06 July 2019, Revision 02 dated 16 October 2019 and Revision 03 dated 07 June 2021.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.



Remarks:

1. This Proposed AD will be closed for consultation 23 July 2021.
2. Enquiries regarding this PAD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this PAD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
4. For any question concerning the technical content of the requirements in this PAD, please contact AIRBUS, as specified below:
EIAW Airworthiness Office E-mail: continued.airworthiness-wb.external@airbus.com;
EIAS Airworthiness Office E-mail: account.airworth-eas@airbus.com;
EIAL Airworthiness Office E-mail: airworthiness.A330-A340@airbus.com.

