



Notification of a Proposal to issue an Airworthiness Directive

PAD No.: 24-082

Issued: 11 July 2024

Note: This Proposed Airworthiness Directive (PAD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

In accordance with the EASA Continuing Airworthiness Procedures, the Executive Director is proposing the issuance of an EASA Airworthiness Directive (AD), applicable to the aeronautical product(s) identified below.

All interested persons may send their comments, referencing the PAD Number above, to the e-mail address specified in the 'Remarks' section, prior to the consultation date indicated.

Design Approval Holder's Name:

SAFRAN HELICOPTER ENGINES

Type/Model designation(s):

ARRIUS 2 engines

Effective Date: [TBD - standard: 14 days after AD issue date]

TCDS Number(s): EASA.E.029

Foreign AD: Not applicable

Supersedure: None

ATA 73 – Engine Fuel & Control – Preference Injector – Non-extinguishing Test / Replacement

Manufacturer(s):

SAFRAN Helicopter Engines (SAFRAN), formerly Turboméca

Applicability:

ARRIUS 2B2, all serial numbers.

These engines are known to be installed on, but not limited to, Airbus Helicopters Deutschland EC135 twin-engine helicopters.

Definitions:

For the purpose of this AD, the following definitions apply:

The MSB1: SAFRAN Mandatory Service Bulletin (MSB) 319 73 2867 version B.

The MSB2: SAFRAN MSB 319 73 2868 version A.



Serviceable part: A preference injector, eligible for installation in accordance with SAFRAN instructions, that is new (not previously installed); or that accumulated less than 500 flight hours (FH) since new or since last repair, as defined in this AD.

Repair: A preference injector repair accomplished in accordance with the instructions of SAFRAN Component Maintenance Manual Ref. X 73 15 06.

Reason:

A review of the data collected by SAFRAN from engines in service indicated that the preference injector may over time clog due to fuel coking, decreasing its permeability.

This condition, if not detected and corrected, and if combined with a sharp reduction in the fuel flow during the flight after a pilot command, could lead to a flame out in the combustion chamber, resulting in engine uncommanded in-flight shut-down, and, in consequence, reduced control of the helicopter.

To address this potential unsafe condition, SAFRAN issued the MSB1 and the MSB2, providing instructions to accomplish non-extinguishing test and replacement of the preference injector at intervals shorter than those published in the Engine Maintenance Manual.

For the reasons described above, this AD requires accomplishment of non-extinguishing tests and replacements of the preference injector at reduced intervals.

Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the action(s) required by this AD have been already accomplished:

Non-extinguishing Tests:

- (1) For engines having modification (mod) TU 117 and mod TU 142 embodied: Within 100 FH(*) after the effective date of this AD, without exceeding 300 FH since last manual non-extinguishing test, and, thereafter, at intervals not exceeding 100 FH(*), perform a manual non-extinguishing test in accordance with the instructions of the MSB1 (see Note 1 of this AD).
- (2) For engines in the pre-TU 117 or pre-TU 142 configuration: Within 100 FH(*) after the effective date of this AD, without exceeding 100 FH since last manual non-extinguishing test, and, thereafter, at intervals not exceeding 100 FH(*), perform a manual non-extinguishing test in accordance with the instructions of the MSB1 (see Note 1 of this AD).

Note 1: A non-cumulative tolerance of 10% may be applied to the compliance times identified by an asterisk (*) in paragraphs (1), (2) and (4) of this AD to allow synchronization of the required inspections with other maintenance tasks, for which a non-cumulative tolerance is already granted in the applicable Maintenance Manual.

Alternative Method of Compliance:

- (3) Accomplishment of a repair or an overhaul on an engine in accordance with the SAFRAN Overhaul Manual, is an acceptable alternative method to the accomplishment of a manual non-extinguishing test as required by paragraph (1) or (2), as applicable, of this AD.



Replacement:

- (4) Within 100 FH after the effective date of this AD, or before the preference injector accumulates 500 FH(*) since new or since last repair, whichever occurs later, without exceeding 850 FH since new or since last repair, and, thereafter, at intervals not exceeding 500 FH(*), replace the preference injector with a serviceable part in accordance with the instructions of the MSB2 (see Note 1 of this AD).

Terminating Action:

- (5) None.

Part(s) Installation:

- (6) From the effective date of this AD, it is allowed to install a preference injector on an engine, provided that the preference injector is a serviceable part, as defined in this AD.

Ref. Publications:

SAFRAN MSB 319 73 2867 version B dated 05 July 2024.

SAFRAN MSB 319 73 2868 version A dated 05 July 2024.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. This Proposed AD will be closed for consultation on 08 August 2024.
2. Enquiries regarding this PAD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
3. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this PAD, and which may occur, or have occurred on a product, part or appliance not affected by this PAD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this PAD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
4. For any question concerning the technical content of the requirements in this PAD, please contact your nearest SAFRAN Helicopter Engines technical representative, or connect to www.tools.safran-helicopter-engines.com.

