

## Airworthiness Directive

**AD No.:** 2025-0205R1

**Issued:** 22 October 2025

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

**Design Approval Holder's Name:**

ATR-GIE AVIONS de TRANSPORT RÉGIONAL

**Type/Model designation(s):**

ATR 42 and ATR 72 aeroplanes

**Effective Date:** Revision 1: 29 October 2025  
 Original issue: 06 October 2025

**TCDS Number(s):** EASA.A.084

**Foreign AD:** Not applicable

**Revision:** This AD revises EASA AD 2025-0205 dated 22 September 2025, which superseded EASA AD 2020-0097R1 dated 28 May 2020.

### ATA 53 – Fuselage – Passenger Seat Tracks – Inspection / Replacement

**Manufacturer(s):**

ATR-GIE Avions de Transport Régional, formerly EADS ATR - Alenia, Aerospatiale Matra ATR - ALENIA, Aerospatiale - Alenia, Aerospatiale - Aeritalia

**Applicability:**

ATR 42-200, ATR 42-300, ATR 42-320, ATR 42-400 and ATR 42-500 aeroplanes, all manufacturer serial numbers (MSN); and

ATR 72-101, ATR 72-102, ATR 72-201, ATR 72-202, ATR 72-211, ATR 72-212 and ATR 72-212A aeroplanes, all MSN.

**Definitions:**

For the purpose of this AD, the following definitions apply:

**The applicable SB:** ATR Service Bulletin (SB) ATR42-53-0160 and SB ATR72-53-1120, as applicable.

**Affected parts:** A seat track having Part Number (P/N) as listed in Appendix 1 of this AD, except :

- Those having a manufacturing stamp corresponding to 'UACE' manufacturer and a year of production equal to or above of 2024; Appendix 2 of this AD provides instructions to identify the manufacturing stamp; and

- Those which have been inspected by the manufacturer (LEONARDO) as per procedure CAR 716-11-23 before the first part delivery and, thereafter, have been delivered as spare parts (independently of the manufacturing stamp); and
- Those which have been manufactured in 2025 or later.

**Serviceable parts:** A seat track, eligible for installation, that is not an affected part, or an affected part that has passed (no deficiencies found) the inspection in accordance with the instructions of the applicable SB or ATR SB ATR42-53-0151 original issue, Revision 1 or Revision 2; or ATR SB ATR72-53-1108 original issue, Revision 1 or Revision 2, as applicable.

**Aeroplane date of manufacture:** The date of transfer of title (ownership) of the aeroplane upon delivery by ATR to the first operator, which is referenced in ATR documentation.

#### Groups:

Group 1 are

ATR 42 aeroplanes:

- MSN 004 to 1603 (inclusive), MSN 1605 to 1616 (inclusive), and
- MSN 1604 and 1618, if a seat track repair or replacement has been performed on the seat tracks having any P/N as listed in the in Appendix 1 of this AD, since the aeroplane date of manufacture.

ATR 72 aeroplanes:

- MSN 108 to 1626 (inclusive), MSN 1628 to 1652 (inclusive), 1654 to 1671 (inclusive), MSN 1673 to 1676 (inclusive), MSN 1679, 1682 to 1685 (inclusive), 1687 to 1693 (inclusive), MSN 1730, 1735 and MSN 1746; and
- MSN 1627, 1672, 1677, 1678, MSN 1694 to 1699 (inclusive), MSN 1701 to 1703 (inclusive), MSN 1705, MSN 1707 to 1709 (inclusive), MSN 1711, 1712 and MSN 1715, if a seat track repair or replacement has been performed on the seat tracks having P/N as listed in Appendix 1 of this AD, since the aeroplane date of manufacture.

Group 2 aeroplanes are those which are not Group 1 aeroplanes.

#### Reason:

Several occurrences have been reported of finding defective seat tracks, either on the ATR final assembly line or during maintenance activities on ATR aeroplanes. Investigation results have identified a potential structural deficiency of those seat tracks under an emergency landing condition.

This condition, if not detected and corrected, could, in case of an emergency landing, lead to a structural failure of the seat track attachment, possibly resulting in injury to occupants, and/or affecting the emergency evacuation.

To address this potential unsafe condition, ATR issued ATR SB ATR42-53-0151 and ATR SB ATR72-53-1108 to provide inspection instructions. Consequently, EASA issued AD 2020-0097 (later revised) to require one-time detailed visual inspection (DVI) and replacement of certain seat tracks, and to provide conditions for (re)installation of those parts.



After that AD was issued, it has been determined that additional seat track P/Ns may be affected and that additional MSNs need to be inspected. Consequently, ATR issued the applicable SB, as defined in this AD, to provide applicable instructions and EASA issued AD 2025-0205 retaining the requirements of EASA AD 2020-0097R1, which was superseded, and expanded the Applicability and the list of affected parts.

Since that AD was issued it was identified that the population of the ATR 72 aeroplanes belonging to the Group 1 can be reduced.

For the reason described above, this AD is revised to reduce the population of Group 1 aeroplanes.

#### Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the action(s) required by this AD have been already accomplished:

#### Inspection(s):

- (1) For Group 1 aeroplanes: Within 26 months after 06 October 2025 [the effective date of this AD at original issue], accomplish a one-time DVI of each affected part in accordance with the instructions of the applicable SB.

#### Corrective Action(s):

- (2) If, during the DVI as required by paragraph (1) of this AD, deficiencies are found, as defined in the SB, within the compliance time specified in Table 1 of this AD, depending on the finding location, accomplish the applicable corrective action(s) in accordance with the instructions of the applicable SB.

Table 1 – Corrective Action(s)

Location	Compliance Time
Finding located at the level of at least one seat fitting	Before next flight
Finding <u>not</u> located at the level of seat fitting	Within 24 months after the inspection as required by paragraph (1) of this AD or at next relocation/replacement of the cabin seats, whichever occurs first

#### Part(s) Installation:

- (3) For Group 1 and Group 2 aeroplanes: From 06 October 2025 [the effective date of this AD at original issue], installation of an affected part on an aeroplane is allowed, provided that the part is a serviceable part, as defined in this AD.

#### Credit:

- (4) Inspection and corrective actions, accomplished on an affected part of the aeroplane before 06 October 2025 [the effective date of this AD at original issue] in accordance with the instruction of ATR SB ATR42-53-0151 original issue, Revision 1, or Revision 2, or ATR SB ATR72-53-1108 original issue, Revision 1, or Revision 2, as applicable, are acceptable to comply with the requirements of paragraphs (1) and (2) of this AD, as applicable, for that affected part of that aeroplane.



**Alternative Method of Compliance:**

- (5) For an aeroplane having a configuration as identified by paragraph (5.1) or (5.2) of this AD, the DVI, as required by paragraph (1) of this AD, is not required on the affected part where the passenger seats, referenced in paragraph (5.1) or (5.2) of this AD, as applicable, are installed, provided that the aeroplane configuration remains unchanged (see Note 1 of this AD).
- (5.1) Aeroplane equipped with passenger seats having P/N listed in the Appendix 3 of this AD **and** WITH at least one of the ATR modifications (MOD) listed in column “MOD 9g” of the Table in Appendix 3 of this AD embodied **and** WITHOUT any MOD listed in column “MOD 16g” embodied; or
- (5.2) Aeroplane equipped with Given seats P/N D5-(xx)-(xxx)-(xxx) or P/N D1-(xx)-(xxx)-(xxx) **and** WITH at least one of the MOD listed in column “MOD 16g” of the Table in Appendix 3 of this AD embodied.

Note 1: Paragraph (5) of this AD is not applicable on the affected part where the forward and aft flight attendant seats are installed.

**Acceptable Method:**

- (6) Accomplishment of the corrective action for an affected part of an aeroplane, as required by paragraph (2) of this AD, can be postponed provided that the related seat (two passengers seat) is blocked for occupancy and marked unserviceable in all flight phases (see Note 2 of this AD).

Note 2: The allowance provided by paragraph (6) of this AD is not applicable to findings located at the level of FWD/AFT attendant seat fittings.

**Ref. Publications:**

ATR SB ATR42-53-0151 original issue dated 20 February 2020, or Revision 1 dated 29 June 2020, or Revision 2 dated 18 January 2023.

ATR SB ATR72-53-1108 original issue dated 26 February 2020, or Revision 1 dated 29 June 2020, or Revision 2 dated 18 January 2023.

ATR SB ATR42-53-0160 original issue dated 07 July 2025.

ATR SB ATR72-53-1120 original issue dated 07 July 2025.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

**Remarks:**

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The original issue of this AD was posted on 25 July 2025 as PAD 25-112 for consultation until 22 August 2025. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed (‘zipped’) file, attached to the record for this AD.



3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: [ADs@easa.europa.eu](mailto:ADs@easa.europa.eu).
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: ATR - GIE Avions de Transport Régional, Continued Airworthiness Service, Telephone: +33 (0)5 62 21 62 21, Fax: +33 (0) 5 62 21 67 18; E-mail: [continued.airworthiness@atr-aircraft.com](mailto:continued.airworthiness@atr-aircraft.com).

Revised




**Appendix 1 – List of Affected Part Number (P/N)**

<b>Section 13</b>	<b>Section 15</b>	<b>Section 16</b>
S53375001-200	S53570201-200	S53678001-200
S53375001-202	S53570201-202	S53678001-201
S53375001-203	S53570201-204	S53678001-202
S53375001-204	S53570201-206	S53678001-210
S53375001-206	S53570203-200	S53678001-216
S53375001-208	S53570203-204	S53678001-220
S53375001-209	S53570203-202	S53678001-222
S53375001-210		S53678001-224
S53375001-212		S53678001-225
S53375001-213		S53678001-226
S53375001-214		S53678001-228
S53375001-216		S53678001-236
S53375001-217		S53678001-238
S53375001-218		S53678001-239
S53375001-220		S53678001-240
S53375001-222		S53678001-242
S53375001-223		S53678001-244
S53375001-224		S53678001-245
		S53678001-246
		S53678001-248
		S53678001-249
		S53678001-250

Revision

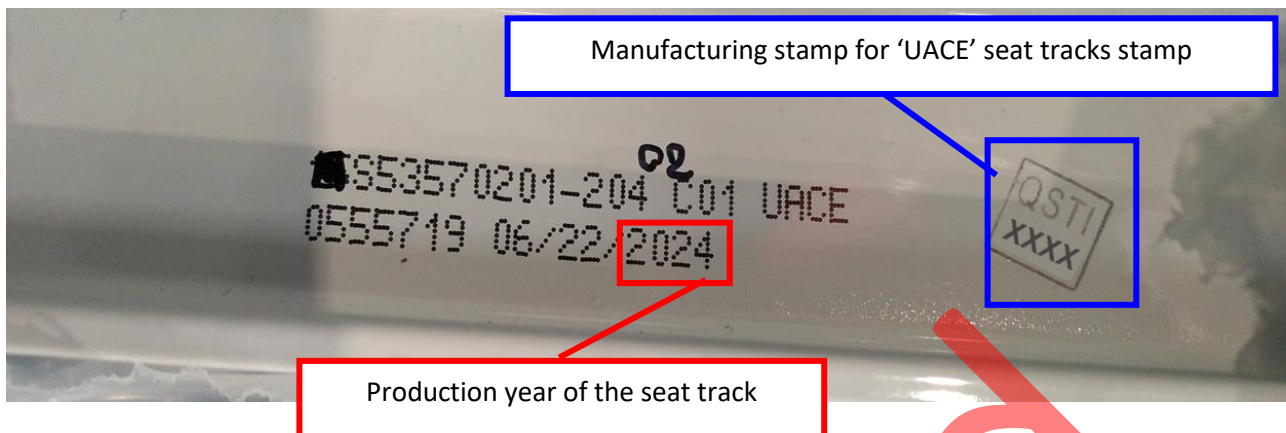

**Appendix 2-** Identification of 'UACE' seat tracks manufactured in or after 2024

The identification of the seat track is located on the lower face of the seat track.

The manufacturing stamp of the seat track on the illustration corresponds to 'UACE' manufacturer, where 'XXXX' represents any numerical sequence.

The production year of the seat track on the illustration is 2024.

All the seat tracks having this manufacturing stamp and a production year equal to or above 2024, do not have to be considered as affected parts.

All the seat tracks with the manufacturing stamp and/or production year not visible/legible, have to be considered as potential affected parts.



**Appendix 3 - 9g/16g Configuration Table**

<b>Pax Seat Supplier</b>	<b>Model</b>	<b>P/N</b>	<b>MOD 9g embodied</b>	<b>MOD 16g embodied</b>
GEVEN	Lightweight Classic & Prestige	D1-01-(xxx)-(xxx)	6291, 6292	6519
		D1-02-(xxx)-(xxx)	6291, 6292, 6583, 6593	6519, 6594
		D1-03-(xxx)-(xxx)	6583, 6593	6594
		D1-06-(xxx)-(xxx)	7269	6594
	MITO	B1-01-(xxx)-(xxx)	6361	N/A
		B1-02-(xxx)-(xxx)	6361	N/A
	Neo classic	D5-01-(xxx)-(xxx)	7871	7781
	Neo prestige	D5-02-(xxx)-(xxx)	7926	7925
Avio	Futura	12P(x)(x)Z(xxxxxx)	N/A	5490
		12M(x)(x)Z(xxxxxx)	N/A	5476
Brice	B1010SS	7069(x)-4(xx)-(xxx)	6008	N/A
Sicma	SK6	94(xx)(x)(xx)-(xx)	N/A	4803
Acro	Superlight R	33-08-41-20(x)	7065	N/A
Expliseat	PT15A	PT15A-(xxxxx)	7492	N/A
	PT15C	PT15C-(xxxxx)	7719	N/A
	PT15E	PT15E-(xxxxx)	7719	N/A

Note 3: 'x' represents any numerical sequence.

MODs listed in the Appendix 3 of this AD could have been embodied through ATR Service Bulletin or Conversion Instruction.

