

Airworthiness Directive

AD No.: 2026-0052

Issued: 12 March 2026

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

AIRBUS HELICOPTERS

Type/Model designation(s):

AS 350 and EC 130 helicopters

Effective Date: 26 March 2026

TCDS Number(s): EASA.R.008

Foreign AD: Not applicable

Supersedure: None

ATA 31 – Instruments – Fuse Cover Attachment of Circuit Breaker Panel – Modification

Manufacturer(s):

Airbus Helicopters (AH), formerly Eurocopter, Eurocopter France, Aerospatiale

Applicability:

AS 350 B2, AS 350 B3 all serial numbers (s/n), on which modification (mod) 073273 and mod 073274 have been embodied, except those which mod 074280 has been embodied; and

EC 130 B4 helicopters, all s/n, on which mod 073245 has been embodied.

Definitions:

For the purpose of this AD, the following definitions apply:

Affected part: Fuse cover having Part Number (P/N) 350A76-2395-20, P/N 350A76-2395-21 or P/N 350A76-2395-23, part of the control unit P/N as listed in Appendix 1 of this AD, except those modified and reidentified in accordance with the instructions of the ASB.

The ASB: AH Alert Service Bulletin (ASB) ASB AS350-31-10-0002 original issue or ASB EC130-31-10-0001 original issue, as applicable.

Reason:

An occurrence of partial blocking of the pilot pedal was reported on a helicopter. Further investigation indicated that this event was caused by an interference between the left pedal of the pilot pedal block and the partially detached fuse cover of the circuit breaker panel.

This condition, if not corrected, could result in reduced yaw control of the helicopter.

To address this potential unsafe condition, AH published the ASB to provide instructions for reinforcement of the fuse cover attachment on the circuit breaker panel.

For the reason described above, this AD requires modification of the installation of the affected part and prohibits installation of affected parts.

Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the actions required by this AD have been already accomplished:

Modification:

- (1) Within 330 flight hours (FH) or 6 months, whichever occurs first after the effective date of this AD, modify the installation of the affected part in accordance with the instructions of the ASB.

Part(s) Installation:

- (2) After modification of a helicopter as required by paragraph (1) of this AD, do not instal an affected part on that helicopter.

Ref. Publications:

AH ASB AS350-31-10-0002 original issue dated 11 February 2026.

AH ASB EC130-31-10-0001 original issue dated 11 February 2026.

The use of later approved revisions of the above-mentioned documents is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. This AD was posted on 20 February 2026 as PAD 26-031 for consultation until 06 March 2026. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than



those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.

5. For any question concerning the technical content of the requirements in this AD, please contact: Airbus Helicopters Customer Support, Telephone +33 (0)4.42.85.97.89, Fax + 33 (0)4.42.85.99.66, E-mail: Airframe.Technical-Support@airbus.com, Technical Request Management: TechnicalSupport.Helicopters@airbus.com.

REVISSED



Appendix 1

Control Unit Affected P/N

| Helicopter Model | Manufacturer P/N | P/N |
|------------------------|----------------------|--------------|
| AS 350 B2 AS 350 B3 | 052706AA | 704A46580115 |
| | 052706B or 052706B-A | 704A46580118 |
| | 074102AA | 704A46580122 |
| | 052706CA | 704A46580123 |
| | 101801AA | 704A46580129 |
| | 104101AA | 704A46580130 |
| | 304-2613-00 | 704A46580140 |
| | 304-2614-00 | 704A46580141 |
| | 304-2615-00 | 704A46580142 |
| | 304-2616-00 | 704A46580143 |
| | 304-2617-00 | 704A46580144 |
| EC 130 B4 | 024803AA | 704A46580112 |
| | 024803B or 024803B-A | 704A46580119 |
| | 074801A or 074801AA | 704A46580124 |
| | 304-2612-00 | 704A46580139 |

