

AIRWORTHINESS DIRECTIVE

released by the Secretariat General
for Civil Aviation

The inspections or modifications described below are mandatory. Failure to comply with Airworthiness Directives entails suspension of the Certificate of Airworthiness (ref. ruling concerning airworthiness conditions for civil aircraft).

AEROSPATIALE HELICOPTERS - ALOUETTE III SA 315 B (LAMA)

MAIN GEAR BOXES

In order to detect a possible adulteration of M.G.B. oil through excessive acidity liable to adversely affect the internal protection of the M.G.B., the following check has been rendered mandatory :

During daily inspection, when checking for correct oil level and condition of the magnetic plug on M.G.B., ascertain that the operating oil is free from adulterations represented by cloudiness, important blackening, abnormal smell, with or without foaming.

If any such defect is found, check for internal condition of M.G.B. housing through the filling and drain holes. If the internal protection is affected, the M.G.B. should be returned to a specialized workshop.

Reference : AEROSPATIALE Service-Bulletin LAMA N° 01.08

Translation of "Consigne de Navigabilité
Réf. 74.79.6"
In case of any difficulty, reference
should be made to the French original text.

Date : 4.7.74

Material : AEROSPATIALE HELICOPTERS
ALOUETTE III SA 315 B (LAMA)

Reference : 74.79.6