

BUREAU VERITAS

AIRWORTHINESS DIRECTIVE

released by Direction Générale de l'Aviation Civile

Inspections and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of "Consigne de Navigabilité"
Réf. : 86-123-017 (B)R1
In case of any difficulty, reference should
be made to the French original issue.

AEROSPATIALE SA 365 N DAUPHIN Helicopters

Main rotor shaft

This Airworthiness Directive applies to AEROSPATIALE DAUPHIN SA 365 N helicopters with main rotor shaft P/N 365 A 31 - 1179 - 03.

Previously to the next inspection of the main rotor shaft scheduled by the AEROSPATIALE Master Servicing Recommendations (MSR), following measures must be taken (unless already accomplished) :

- 1/ Eliminate the polyurethane shock-proofing coating of main rotor shaft in accordance with instructions of S.B. AEROSPATIALE SA 365 N n° 01-17 Rev.1 (or later approved revisions) in order to facilitate further inspections :
 - 1.1. - Immediately in case of a sudden or repeating important tracking,
 - 1.2. - At the latest within 300 operating hours following the date of reception of this Airworthiness Directive.
 - 1.3. - Before setting into service a main rotor shaft.
- 2/ Mention on the Equipment Log Card of the main rotor shaft accomplishment of the referenced Service Bulletin.
- 3/ After application of this Airworthiness Directive, comply with instructions of A. D. 84-20-6 (B) R2 or later amended.

Ref. SB AEROSPATIALE n° 01-17 Rev. 1 (or later approved revisions).

EFFECTIVE DATE OF APPLICATION : AT THE RECEPTION
(same as original issue)

This Revision 1 cancels and replaces the original A.D. n° 86-123-017(B) dated 6th August 1986.

Dated : March 18, 87

AEROSPATIALE Helicopters
DAUPHIN SA 365 N

Ref. : 86-123-017(B)R1