

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

**Translation of 'Consigne de Navigabilité' ref. : 91-243-022(B)
In case of any difficulty, reference should be made to the French original issue.**

AIRBUS INDUSTRIE

A320 aircraft

CFM 56-5 electrical harnesses

The present Airworthiness Directive applies to AIRBUS INDUSTRIE A320 aircraft models 111, 211 and 212 fitted with CFM 56-5 engines equipped with electrical harnesses part number 238W0904-509, 238W0904-511 and 238W0908-511 without AIRBUS INDUSTRIE modification 22673 or without ROHR Service Bulletin RA32071-63.

In order to prevent uncontrolled engine power reduction resulting from multiple thrust reverser position alarms caused by the presence of humidity or corrosion, the following actions are rendered mandatory :

- 1/** No later than 100 flight hours from the effective date of this Airworthiness Directive, visually inspect the electrical harnesses part number 238W0904-509, 238W0904-511 and 238W0908-511 and perform draining provision in accordance with AIRBUS INDUSTRIE ALL OPERATORS TELEX reference AOT 71-01 revision 1 dated October 22, 1991.
- 2/** Remove and modify the electrical harnesses in accordance with AIRBUS INDUSTRIE ALL OPERATORS TELEX AOT 71-01 revision 1 dated October 22, 1991 :
 - a.** within 600 flight hours if humidity or corrosion was detected during the visual inspection.
 - b.** within 3000 flight hours if neither humidity nor corrosion was detected during the visual inspection.

No further action is required after accomplishment of the present Airworthiness Directive or AOT 71-01 revision 1 dated October 22, 1991.

Ref. : AIRBUS INDUSTRIE ALL OPERATORS TELEX AOT 71-01 Revision 1 dated October 22, 1991.

EFFECTIVE DATE : UPON RECEIPT

e/C

November 13, 1991

**AIRBUS INDUSTRIE
A320 aircraft**

91-243-022(B)