# **AIRWORTHINESS DIRECTIVE**

## released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of 'Consigne de Navigabilité' ref. : 1998-293-118(B) R1 In case of any difficulty, reference should be made to the French original issue.

## **AIRBUS INDUSTRIE**

#### A319/A320/A321 Aircraft

IAE front engine mount modification (ATA 71)

## **APPLICABILITY**

This Airworthiness Directive applies to AIRBUS INDUSTRIE A319-131, A319-132, A320-232, A320-233, A321-131 and A321-231 aircraft models, all serial numbers, without AIRBUS INDUSTRIE modification 27020 or without AIRBUS INDUSTRIE Service Bulletin A320-71-1021.

## **REASON**

On some aircraft in service equipped with V2500-A5, the forward engine mount assembly could not comply with the latest specification of torque values for the stop plate and Monoball housing bolts.

# **ACTION**

**December 16, 1998** 

Within 500 flight hours following the effective date of this Airworthiness Directive at original issue. Identify the forward engine mount P/N for each engine :

- if the P/N is 740-2010-513N, before 2250 flights, reindentify the forward engine mount with 740-2010-517 in accordance with instructions given in AIRBUS INDUSTRIE Service Bulletin A320-71-1021,
- if the P/N is different from 740-2010-513N, before the next flight, do a visual inspection of the thrust link, in accordance with instructions given in AIRBUS INDUSTRIE Bulletin Service A320-71-1021 :
  - if defects are found, then apply corrective actions as defined in AIRBUS INDUSTRIE Service Bulletin A320-71-1021, before the next flight,
  - if no defect, then within 2250 flight cycles following the 1<sup>st</sup> inspection, modify and reidentify with 740-2010-517 the engine mount in accordance with instructions given in AIRBUS INDUSTRIE Service Bulletin A320-71-1021.

REF.: AIRBUS INDUSTRIE Service Bulletin A320-71-1021 (or any further approved revision)

This Revision 1 replaces AD 1998-293-118(B) dated July 29, 1998.

**EFFECTIVE DATES:** 

Original AD: AUGUST 08, 1998

n/JJD

AIRBUS INDUSTRIE
A319/A320/A321 Aircraft

1998-293-118(B) R1

GSAC	AIRWORTHINESS DIRECTIVE		ref. :	98-293-118(B) R1	Page n°	2
	Revision 1 : DECEMBER 26, 1998					