GSAC

AIRWORTHINESS DIRECTIVE

released by DIRECTION GENERALE DE L'AVIATION CIVILE

Inspection and/or modifications described below are mandatory. No person may operate a product to which this Airworthiness Directive applies except in accordance with the requirements of this Airworthiness Directive.

Translation of 'Consigne de Navigabilité' ref. : 1999-143-114(B) In case of any difficulty, reference should be made to the French original issue.

AIRBUS INDUSTRIE

A340 Aircraft

Flight control unit (FCU) (ATA 22)

APPLICABILITY:

AIRBUS INDUSTRIE A340 aircraft models -211, -212, -213, -311, -312 and -313, which have received AIRBUS INDUSTRIE modification 44887 or Service Bulletin A340-22-4012, and which have not received one or both of the following AIRBUS INDUSTRIE modifications or Service Bulletins:

- modification 46170 (Service Bulletin A340-22-4020)
- modification 46596 (Service Bulletin A340-22-4019)

REASONS:

Following to the installation of the Auto Flight - Flight Control Unit (FCU) P/N K274AAM0507 on A330/A340 aircraft it has been reported the loss of the following functions during take-off :

- total loss of auto-pilot, flight director and auto thrust function,
- when the selected range was different from 80 NM, loss of map display with "MAP NOT AVAIL" flag.

A double failure, combined to severe weather conditions, could lead to an increased workload for the flight crew to manage the control of the aircraft.

COMPLIANCE:

April 07, 1999

The following measures are rendered mandatory on the effective date of this Airworthiness Directive:

Before June 30th, 1999 unless previously accomplished,

- (i) remove from the aircraft the Flight Control Unit P/N K274AAM0507,
- (ii) install a Flight Control Unit P/N K274AAM0506 in accordance with instructions given in AIRBUS INDUSTRIE Service Bulletin A340-22-4020.

.../...

n/GH

AIRBUS INDUSTRIE
A340 Aircraft

1999-143-114(B)

AIRWORTHINESS DIRECTIVE

ref.: 1999-143-114(B) Page n°

2

Alternative solution:

(ii) installation of Flight Control Unit P/N K274AAM0608 in accordance with instructions given in AIRBUS INDUSTRIE Service Bulletin A340-22-4019.

REF.: AIRBUS INDUSTRIE Service Bulletin A340-22-4019

(or any further approved revision)

AIRBUS INDUSTRIE Service Bulletin A340-22-4020

(or any further approved revision)

EFFECTIVE DATE: APRIL 17, 1999