

**ILMAILULAITOS**  
CIVIL AVIATION ADMINISTRATION

PL 50  
FIN - 01531 VANTAA, FINLAND  
Puhelin/Telephone 09 - 82 771  
International + 358 9 82 771  
Telefax 09 - 82 772499

**LENTOTURVALLISUUSHALLINTO**  
FLIGHT SAFETY AUTHORITY

**LENTOKELPOISUUSMÄÄRÄYS**  
AIRWORTHINESS DIRECTIVE



**M 637/75**

28.10.1975

The modification described in this Airworthiness Directive is necessary for the continuous airworthiness of the aircraft, The work performed is to be files in the Journey Log Book.

**PIK-20. Wearing of the rudder operating cable**

**Applicability:** PIK-20 sailplanes with serial numbers 20004 to 20058

**Reference:** Molino Oy Service Bulletin no. M6.

**Accomplishment:** At the next monthly or annual inspection after 1<sup>st</sup> November 1976.

**Action:**

1. Inspect in accordance with the referenced Service Bulletin whether the geared rod has been rubbing against the rudder cable cover. If the cover tube has been badly worn replace the damaged area and if the cable has been damaged replace it.
2. Bond the cover tube to the fuselage outer skin in accordance with the referenced Service Bulletin.