


EASA	AIRWORTHINESS DIRECTIVE																																
	<p style="text-align: center;">AD No : 2006 - 0203</p> <p style="text-align: center;">Date: 11 July 2006</p>																																
<p>No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of that Airworthiness Directive unless otherwise agreed with the Authority of the State of Registry.</p>																																	
<p>Type Approval Holder's Name : AIRBUS</p>	<p>Type/Model designation(s) : A318/A319/A320/A321 Aircraft</p>																																
<p>TCDS Number : EASA A.064</p>																																	
<p>Foreign AD : none</p>																																	
<p>Supersedure : none</p>																																	
<p>ATA 28</p>	<p style="text-align: center;">Fuel - Fuel Tank Safety ALS Part 5 - Fuel Airworthiness Limitations (FAL)</p>																																
<p>Manufacturer(s):</p>	<p>AIRBUS (formerly AIRBUS INDUSTRIES)</p>																																
<p>Applicability:</p>	<p>AIRBUS aircraft models:</p> <table border="0" style="width: 100%;"> <tr> <td>A318-111</td> <td>A319-111</td> <td>A320-111</td> <td>A321-111</td> </tr> <tr> <td>A318-112</td> <td>A319-112</td> <td>A320-211</td> <td>A321-112</td> </tr> <tr> <td>A318-121</td> <td>A319-113</td> <td>A320-212</td> <td>A321-131</td> </tr> <tr> <td>A318-122</td> <td>A319-114</td> <td>A320-214</td> <td>A321-211</td> </tr> <tr> <td></td> <td>A319-115</td> <td>A320-231</td> <td>A321-212</td> </tr> <tr> <td></td> <td>A 319-131</td> <td>A320-232</td> <td>A321-213</td> </tr> <tr> <td></td> <td>A319-132</td> <td>A320-233</td> <td>A321-231</td> </tr> <tr> <td></td> <td>A319-133</td> <td></td> <td>A321-232,</td> </tr> </table> <p>all serial numbers.</p>	A318-111	A319-111	A320-111	A321-111	A318-112	A319-112	A320-211	A321-112	A318-121	A319-113	A320-212	A321-131	A318-122	A319-114	A320-214	A321-211		A319-115	A320-231	A321-212		A 319-131	A320-232	A321-213		A319-132	A320-233	A321-231		A319-133		A321-232,
A318-111	A319-111	A320-111	A321-111																														
A318-112	A319-112	A320-211	A321-112																														
A318-121	A319-113	A320-212	A321-131																														
A318-122	A319-114	A320-214	A321-211																														
	A319-115	A320-231	A321-212																														
	A 319-131	A320-232	A321-213																														
	A319-132	A320-233	A321-231																														
	A319-133		A321-232,																														
<p>Reason:</p>	<p>Subsequent to accidents involving Fuel Tank System explosions in flight (Boeing 747-131 flight TWA800) and on ground, the FAA published Special Federal Aviation Regulation 88 (SFAR88) in June 2001. SFAR 88 required a safety review of the aircraft Fuel Tank System to determine that the design meets the requirements of FAR § 25.901 and § 25.981(a) and (b).</p>																																

	<p>A similar regulation has been recommended by the JAA to the European National Aviation Authorities in JAA letter 04/00/02/07/03-L024 of 3 February 2003. The review was requested to be mandated by NAA's using JAR § 25.901(c), § 25.1309.</p> <p>In August 2005 EASA published a policy statement on the process for developing instructions for maintenance and inspection of Fuel Tank System ignition source prevention (EASA D 2005/CPRO, www.easa.eu.int/home/cert_policy_statements_en.html) that also included the EASA expectations with regard to compliance times of the corrective actions on the unsafe and the not unsafe part of the harmonised design review results. On a global scale the TC holders committed themselves to the EASA published compliance dates (see EASA policy statement). The EASA policy statement has been revised in March 2006: the date of 31-12-2005 for the unsafe related actions has now been set at 01-07-2006.</p> <p>Fuel Airworthiness Limitations are items arising from a systems safety analysis that have been shown to have failure mode(s) associated with an 'unsafe condition' as defined in FAA's memo 2003-112-15 'SFAR 88 – Mandatory Action Decision Criteria'. These are identified in Failure Conditions for which an unacceptable probability of ignition risk could exist if specific tasks and/or practices are not performed in accordance with the manufacturers' requirements.</p> <p>This EASA Airworthiness Directive mandates the Fuel Airworthiness Limitations, comprising maintenance/inspections tasks and Critical Design Configuration Control Limitations (CDCCL), for the type of aircraft that resulted from the design reviews and the JAA recommendation and EASA policy statement mentioned above.</p>
Effective Date:	19 July 2006
Compliance:	<p>Unless already accomplished, the following actions are rendered mandatory:</p> <ol style="list-style-type: none"> 1. Maintenance/Inspection Tasks: <ul style="list-style-type: none"> - Within 3 months from the effective date of this AD, it is mandatory to strictly adhere to the requirements of AIRBUS ALS part 5, Fuel Airworthiness Limitations Section 1 as defined in document A318/A319/A320/A321 Fuel Airworthiness Limitations, 95A.1931/05 at Issue 1 or later approved version. <p>At the effective date of this AD, for the aircraft in service, defined intervals for FAL have to be counted from this AD effective date.</p> 2. CDCCL <ul style="list-style-type: none"> - It is the responsibility of the operator to ensure that their internal documentation is amended to reflect the data contained within AIRBUS ALS Part 5, Fuel Airworthiness Limitations Section 2 and to provide appropriate text to highlight the existence of each CDCCL. The operators internal procedures and documentation ensuring management of control of CDCCL shall be fully implemented before 01 July 2007.

	<ul style="list-style-type: none"> - No retroactive action on aircraft in service is required further to the above mentioned amendment of the documentation.
Ref. Publications:	A320 Fuel Airworthiness Limitations, 95A.1931/05 Issue 1, or later approved revisions.
Remarks :	<ol style="list-style-type: none"> 1. If requested and appropriately substantiated the responsible EASA manager for the related product has the authority to accept Alternative Methods of Compliance (AMOCs) for this AD. 2. This AD was posted as PAD 06-006R1 for consultation on 07 June 2006 with a comment period until 22 June 2006. PAD 06-006R1 has been issued to endorse comments received for PAD 06-006 and due to the change of the EASA policy statement on fuel tank safety on March 2006. The Comment Response Document can be found at http://ad.easa.eu.int/ . 3. Enquiries regarding this Airworthiness Directive should be referred to Mr. M. Capaccio, Airworthiness Directive Focal Point - Certification Directorate, EASA. E-mail: ADs@easa.europa.eu . 4. For any question concerning the technical content of the requirements in this AD, please contact AIRBUS EAS - Fax +33 5 61 93 44 51

SUPERSEDED