## **EASA**

## **AIRWORTHINESS DIRECTIVE**



AD No.: 2006 - 0272

Date: 04 September 2006

No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of that Airworthiness Directive unless otherwise agreed with the Authority of the State of Registry.

Type Approval Holder's Name:

Type/Model designations:

**EUROCOPTER** 

EC 130 B4 helicopters

TCDS Number: EASA R.008

Foreign AD: Not applicable.

Supersedes: DGAC F-2005-145, EASA approval No. 2005-6136

ATA 76	Engine Controls – Twist Grip Assembly – Inspection/Modification
	T
Manufacturer(s):	EUROCOPTER [formerly EUROCOPTER FRANCE]
Applicability:	EUROCOPTER EC 130 B4 helicopters equipped with twist grips not modified per modification 073773.
Reason:	This Airworthiness Directive (AD) is issued following two reports of twist grip jamming in the "IDLE" position:
	- the first case occurred after landing,
	<ul> <li>the second case occurred during an autorotation training procedure with engine power recovery. The autorotation procedure was continu- without damage until the complete landing of the helicopter.</li> </ul>
	Analysis has revealed:
	<ul> <li>in the first case: a foreign body (chip) between the roller of the "FLIGHT" micro-switch and the cam, causing the "FLIGHT" micro-switch to jam in the "IDLE" detent,</li> </ul>
	- in the second case: some marks on the cam.
	Following these incidents, the DGAC issued AD F-2005-145 to require a functional check of the twist grip assembly at regular intervals.

	The purpose of this AD, which supersedes AD F-2005-145, is:
	<ul> <li>To cover the replacement of Alert Telex No. 05A003 by an Alert Service Bulletin (ASB) with the same reference number and with no change to the technical content.</li> </ul>
	<ul> <li>To make embodiment of modifications 073773 and 073683 mandatory.</li> <li>Embodiment of these modifications cancels the checks called for in paragraph 1 of this AD.</li> </ul>
Effective Date:	14 September 2006
Compliance:	The following measures are mandatory as from August 9, 2005, the effective date of DGAC AD F-2005-145:
	1.1. Unless already carried out during the previous "100-hour or 12-month" inspection, perform a functional check of the twist grip assembly and check its condition no later than within the next 30 flying hours, then at intervals not exceeding 110 flying hours, in compliance with paragraph 2.B.2. of referenced ASB No. 05A003.
	1.2. Each time you carry out work in the area of the twist grip assembly, which may lead to ingress of chips or foreign bodies, comply with paragraph 2.B.2. of referenced ASB No. 05A003.
	2. The following measures are mandatory as from the effective date of this AD:
	2.1. Twist grip assemblies installed on board:
	Modify the twist grip assemblies in compliance with paragraph 2.B. of ASB No. 67A009, at the latest by December 31, 2006.
	<b>2.2.</b> Twist grip assemblies held as spares:
	Before installation on a helicopter or at the latest by December 31, 2006, modify the twist grip assemblies, in compliance with paragraph 2.B.6. of ASB No. 67A009.
	<b>Not</b> e: Compliance with the measures specified in paragraph 2 cancels the instructions given in paragraph 1.
Ref. Publications:	EUROCOPTER EC 130 Alert Service Bulletins (ASB) No. 05A003 dated July 13, 2006 and No. 67A009 dated July 12, 2006 or later approved revisions.
Remarks:	If requested and appropriately substantiated the responsible EASA manager for the related product has the authority to accept Alternative Methods of Compliance (AMOCs) for this AD.
	<ol> <li>This AD was posted as PAD 06-187 for consultation on 18 July 2006 with a comment period until 8 August 2006. No comments were received during the consultation period.</li> </ol>
	<ol> <li>Enquiries regarding this AD should be addressed to the AD Focal Point, Certification Directorate, EASA. E-mail: <a href="mailto:ADs@easa.europa.eu">ADs@easa.europa.eu</a></li> </ol>
	<ol> <li>For any questions concerning the technical content of the requirements in this AD, please contact: EUROCOPTER (STDI) - Aéroport de Marseille Provence 13725 Marignane Cedex - France. Ph: 33 (0) 4 42 85 97 97 - Fax: 33 (0) 4 42 85 99 66. E-mail: <a href="mailto:Directive.technical-support@eurocopter.com">Directive.technical-support@eurocopter.com</a></li> </ol>