


EASA	AIRWORTHINESS DIRECTIVE	
	<p style="text-align: center;">AD No.: 2006 - 0366</p> <p style="text-align: center;">Date: 11 December 2006</p>	
<p>No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of that Airworthiness Directive unless otherwise agreed with the Authority of the State of Registry.</p>		
<p>Type Approval Holder's Name :</p> <p>DASSAULT AVIATION</p>	<p>Type/Model designation(s):</p> <p>MYSTERE-FALCON 50</p>	
<p>TCDS Number : EASA A.062</p>		
<p>Foreign AD : Not applicable.</p>		
<p>Supersedure : Not applicable.</p>		
ATA 25	Equipment – Life Raft – Inspection / Replacement	
<p>Manufacturers :</p>	<p>DASSAULT AVIATION (formerly Avions Marcel Dassault-Breguet Aviation)</p>	
<p>Applicability :</p>	<p>MYSTERE–FALCON 50 airplanes, serial numbers 294, 299, 301 through 304, 306, 307, 310, 313, 314, 316 through 320, 322 through 331, 334 through 337 and 339, except airplanes which have already implemented the Dassault Aviation Service Bulletin (SB) F50-480</p>	
<p>Reason :</p>	<p>Some occurrences have been reported where life rafts were difficult to remove from inside divan compartment. Investigations revealed that :</p> <ul style="list-style-type: none"> - Life raft was incorrectly stowed, with deployment straps inboard; - Life raft had not been repacked to specified dimensions <p>The purpose of this Airworthiness Directive (AD) is to verify that all life rafts are stowed correctly with deployment straps outboard, and are repacked to specified dimensions.</p>	
<p>Effective Date :</p>	<p>14 December 2006</p>	
<p>Compliance :</p>	<p>The following measures are rendered mandatory from the effective date of this AD.</p>	

	<p>A) <u>Within the next 10 flight cycles after the effective date of this AD:</u></p> <p>1/ Verify that the life rafts are stowed correctly, with deployment straps outboard, in accordance with the instructions specified in Dassault Service Bulletin (SB) F50-480.</p> <p>2/ If a life raft is found incorrectly stowed, before next flight, reinstall it in accordance with the instructions specified in Dassault SB Part F50-480-1.</p> <p>3/ Verify that the overall dimensions of the life raft hard pack do not exceed nominal values, as indicated in the Dassault Aviation SB Part F50-480-1. In case of exceedance, before next flight, remove the defective life raft hard pack, return it to an authorized repair station to apply the Winslow Service Bulletin No.29 and proceed with paragraph B/ of this directive.</p> <p>B) <u>Within 3 months after the effective date of this AD:</u></p> <p>1/ Reinstall the properly repacked life raft as instructed in the referenced SB Part F50-480-2.</p> <p>2/ Install placards on the sofa in accordance with the instructions specified in the referenced SB Part F50-480-2</p> <p>Note: Notice that with no life raft aboard, local national operating regulations may not allow some extended overwater flights.</p>
<p>Ref. Publications :</p>	<p>Dassault Aviation SB F50-480, original issue.</p> <p>Winslow Service Bulletin No.29, original issue.</p> <p>or later approved revisions of these documents.</p>
<p>Remarks :</p>	<ol style="list-style-type: none"> 1. If requested and appropriately substantiated the responsible EASA manager for the related product has the authority to accept Alternative Methods of Compliance (AMOCs) for this AD. 2. This AD was posted as PAD 06-238 for consultation on 26 October 2006 with a comment period until 20 November 2006. No comments were received during the consultation period. 3. Enquiries regarding this AD should be addressed to the AD Focal Point, Certification Directorate, EASA. E-mail: ADs@easa.europa.eu 4. For any questions concerning the technical content of the requirements in this AD, please contact your Dassault Customer Service manager / Field Service representative or Dassault Falcon Technical Assistance: <ul style="list-style-type: none"> - For Europe, Middle East and Africa based operators : Hot Line : (33) 1 47 11 35 35 Fax (33)1 47 11 89 49 - For USA, Canada and Mexico based operators : Help Desk : (1) 800-2FALCON (2325266) Fax (1)201 541 4740 - All other areas : Help Desk : (1) 201 541 4747 Fax (1)201 541 4740