EASA

EMERGENCY AIRWORTHINESS DIRECTIVE

AD No.: 2012-0077-E

Date: 03 May 2012

Note: This Emergency Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with EC 1702/2003, Part 21A.3B. In accordance with EC 2042/2003 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [EC 2042/2003 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [EC 216/2008, Article 14(4) exemption].

Type Approval Hol AgustaWestland S.p		Type/Model designation(s) : AB412 and AB412EP helicopters
TCDS Number:	ENAC Italy SO/A 375	
Foreign AD:	Not applicable	
Supersedure:	None	
ATA 25	Equipment & Furnis	hings – Hoist Hook – Inspection
Manufacturer(s):		(formerly Agusta S.p.A.), AgustaWestland n (formerly Agusta Aerospace Corporation).
Applicability:	AB412 and AB412EP he	elicopters, all serial numbers.
Reason:	AB412 helicopter. The in	orted where the hoist hook separated from an Agusta nitial results of the technical investigation revealed g hook were not properly attached.
5	external load or person	ected and corrected, could lead to detachment of an from the helicopter hoist, possibly resulting in to persons on the ground.
		al unsafe condition, AgustaWestland issued Bollettino which provides instructions to inspect the hoist hook.
	with hoist hook assembl of the hoist hook and, do installation attachment.	ed above, this AD requires, for helicopters equipped ly Part Number (P/N) HK-118-2, a one-time inspection epending on findings, correction of the hoist hook In addition, this AD requires repetitive inspections of on after each disassembly.
Effective Date:	04 May 2012	

Doguirod Action(a)	
Required Action(s)	Required as indicated, unless accomplished previously:
and Compliance Time(s):	(1) Before next flight after the effective date of this AD, for helicopters equipped with hoist P/N 412-8800-01-202 (Breeze Eastern P/N BL- 20200-402) and/or hoist P/N 412-8800-01-412 (Breeze Eastern P/N B 20200-412), where hoist hook assembly P/N HK-118-2 is installed, inspect the hoist hook assembly in accordance with the instructions of AgustaWestland BT 412-132.
	(2) After the effective date of this AD, before next flight following each disassembly and subsequent reassembly of the hoist hook assembly I HK-118-2, inspect the hoist hook assembly in accordance with the instructions of AgustaWestland BT 412-132.
	(3) If, during any inspection as required by paragraph (1) or (2) of this AD as applicable, a discrepancy is detected, before next flight, correct the hoist hook assembly installation in accordance with the instructions of AgustaWestland BT 412-132.
	(4) From the effective date of this AD, do not install on a helicopter a hois hook assembly P/N HK-118-2, unless it has passed the inspection in accordance with the instructions of AgustaWestland BT 412-132.
Ref. Publications:	AgustaWestland BT 412-132 original issue dated 02 May 2012.
	The use of later approved revisions of this document is acceptable for compliance with the requirements of this AD.
Remarks :	 If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
	The safety assessment has requested not to implement the full consultation process and an immediate publication and notification.
	 Enquiries regarding this AD should be referred to the Safety Information Section, Executive Directorate, EASA. E-mail: <u>ADs@easa.europa.eu</u>.
	 For any question concerning the technical content of the requirements this AD, please contact: AgustaWestland S.p.A. Customer Support