


<b>EASA</b>	<b>AIRWORTHINESS DIRECTIVE</b>
	<p><b>AD No.: 2013-0096</b></p> <p><b>Date: 18 April 2013</b></p> <p>Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) No 216/2008 on behalf of the European Community, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.</p>
<p>This AD is issued in accordance with EU 748/2012, Part 21.A.3B. In accordance with EC 2042/2003 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [EC 2042/2003 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [EC 216/2008, Article 14(4) exemption].</p>	
<p><b>Design Approval Holder's Name:</b></p> <p>ROLLS-ROYCE PLC</p>	<p><b>Type/Model designation(s):</b></p> <p>Trent 1000 engines</p>
TCDS Number:	EASA.E.036
Foreign AD:	Not applicable
Supersedure:	None
<b>ATA 72</b>	<b>Engine – Intermediate Pressure Turbine Blades – Inspection</b>
Manufacturer(s):	Rolls-Royce plc
Applicability:	<p>Trent 1000-A, Trent 1000-C, Trent 1000-D, Trent 1000-E, Trent 1000-G and Trent 1000-H engines, all serial numbers.</p> <p>These engines are known to be installed on, but not limited to, Boeing 787 series aeroplanes.</p>
Reason:	<p>During overhaul and on-wing inspections, Intermediate Pressure Turbine (IPT) blades Part Number (P/N) FW63838 have been found with missing rear seal fins. Release of an IPT blade rear seal fin may result in downstream, secondary damage, potentially accompanied with engine power loss.</p> <p>This condition, if not detected and corrected, could lead to an in-flight shut-down resulting in reduced control to the aeroplane.</p> <p>For the reasons described above, this AD requires repetitive borescope inspections and, depending on findings, removal from service of the engine.</p> <p>This AD is considered an interim action, pending the development of a modification that will enhance the capability of the engine to sustain non-uniform loads, which is expected to be terminating action for the repetitive inspections as required by this AD.</p>
Effective Date:	02 May 2013

<p>Required Action(s) and Compliance Time(s):</p>	<p>Required as indicated, unless accomplished previously:</p> <ol style="list-style-type: none"> <li>(1) For all engines fitted with P/N FW63838 IPT blades, before exceeding 450 flight cycles (FC) since new, and, thereafter, at intervals not to exceed 200 FC, accomplish an on-wing borescope inspection in accordance with the instructions of Section 3 of Rolls-Royce Non-Modification Service Bulletin (NMSB) TRENT 1000 72-AH260 (hereafter referred to as the NMSB).</li> <li>(2) From the effective date of this AD, each time the engine is inducted into an engine shop, accomplish a borescope inspection in accordance with the instructions of Section 3 of the NMSB.</li> </ol> <p>Note: Accomplishment of an in shop inspection as required by paragraph (2) of this AD is acceptable in lieu of an on-wing borescope inspection as required by paragraph (1) of this AD.</p> <ol style="list-style-type: none"> <li>(3) If, during any inspection as required by paragraph (1) or (2) of this AD, two or more IPT blade rear seal fins are found broken or missing, or damage on the rear of an IPT blade or on the front of a Stage 1 low pressure turbine blade is found, outside the applicable limits as specified in the relevant Aircraft Maintenance Manual tasks referenced in Section 3 of the NMSB, the engine must be removed from service.</li> <li>(4) From the effective date, installation of P/N FW63838 IPT blades on an engine is allowed, provided that, following installation, the engine is inspected as required by this AD.</li> </ol>
<p>Ref. Publications:</p>	<p>Rolls-Royce Trent 1000 NMSB 72-AH260, Initial Issue dated 26 March 2013.</p> <p>The use of later approved revisions of this document is acceptable for compliance with the requirements of this AD.</p>
<p>Remarks:</p>	<ol style="list-style-type: none"> <li>1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.</li> <li>2. Based on the required actions and the compliance time, EASA have decided to issue a Final AD with Request for Comments, postponing the public consultation process until after publication.</li> <li>3. Enquiries regarding this AD should be referred to the Safety Information Section, Executive Directorate, EASA. E-mail: <a href="mailto:ADs@easa.europa.eu">ADs@easa.europa.eu</a>.</li> <li>4. For any question concerning the technical content of the requirements in this AD, please contact your designated Rolls-Royce representative, or download the publication from your Aeromanager account at <a href="http://www.aeromanager.com">www.aeromanager.com</a>, or contact Rolls-Royce plc, Corporate Communications, P.O. Box 31, Derby, DE24 8BJ, United Kingdom, telephone: +44 (0) 1332 242424, or send an e-mail through <a href="http://www.rolls-royce.com/contact/civil_team.jsp">http://www.rolls-royce.com/contact/civil_team.jsp</a> identifying the correspondence as being related to <b>Airworthiness Directives</b>.</li> </ol>