


EASA	PROPOSED AIRWORTHINESS DIRECTIVE	
	<p>PAD No : 07-149</p> <p>Date: 31 August 2007</p>	
No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of that Airworthiness Directive unless otherwise agreed with the Authority of the State of Registry.		
Type Approval Holder's Name :	Type/Model designation(s) :	
The Boeing Company	727 series	
TCDS Number: FAA A3WE		
Foreign AD: This AD is related to, and prompted by NPRM Docket Nr. FAA-2007-28382.		
Supersedure: For aircraft that operate under EASA Regulations, the requirements of this AD take precedence over those contained in FAA AD 2007-XX-XX (TPD)		
ATA 28	Fuel System and Fuel Tank System Airworthiness Limitations (AWL) - Implementation	
Manufacturer(s):	Boeing Aircraft Company	
Applicability:	Model 727, 727C, 727-100, 727-100C, 727-200 and 727-200F series aircraft, all serial numbers.	
Reason:	<p>The FAA proposes to adopt a new airworthiness directive (AD) for all Boeing Model 727 series aircraft. This proposed AD would require revising the FAA-approved maintenance program by incorporating new airworthiness limitations (AWLs) for fuel tank systems to satisfy Special Federal Aviation Regulation No. 88 requirements. This proposed AD would also require the initial inspection of certain repetitive AWL inspections to phase in those inspections, and repair if necessary. This proposed AD results from a design review of the fuel tank systems. The FAA is proposing this AD to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with flammable fuel vapours, could result in a fuel tank explosion and consequent loss of the aircraft.</p> <p>FAA NPRM Docket Nr. FAA-2007-28382 (copy attached) proposes to mandate the Fuel System Airworthiness Limitations, including the Critical Design Configuration Control Limitations (CDCCL), for Boeing 727 series aircraft with a final compliance date of 16 December 2008. However, Boeing has voluntarily anticipated and respected the "EASA policy statement on the process for developing instructions for maintenance and inspection of fuel tank ignition source prevention" [EASA D 2005/CPRO, later revised EASA D 2006/CPRO, 8 March 2006] by publishing the Fuel System Airworthiness Limitations in Boeing 727-100/200 Airworthiness Limitations (AWLs) Document, D6-8766-AWL, original release, dated March 2006.</p>	

WITHDRAWN

	<p>The EASA compliance time schedule is considered to be a straightforward application of Regulation (EC) No 2042/2003 Part M.A.302 in relation to the publication of the Airworthiness Limitations (including CDCCL) by the Boeing Airplane Company in the 727-100/200 AWL Document, D6-8766-AWL.</p> <p>According to Part M.A.302(f) and (g), operators should have been aware of these Fuel Airworthiness Limitations as published by Boeing and implemented these into their aircraft maintenance programme as a result of the required annual review.</p> <p>With this EASA AD, EASA endorses the technical content of the FAA AD 2007-XX-XX [TBD].</p> <p>However, in deviation from the FAA AD, EASA requires the incorporation of the relevant tasks into the aircraft maintenance programme before 01 December 2007. Particular attention is requested with regard to the implementation of the required threshold inspections and grace periods, and the Aircraft Maintenance Manual (AMM), Standard Practices & Wiring Manual (SPWM) and Component Maintenance Manual (CMM) references, as given in the FAA Airworthiness Directive.</p>
Effective Date:	[TBD: 14 days after final AD issue date]
Compliance:	<p>EASA endorses the technical content of FAA AD 2007-XX-XX [TBD; currently NPRM Docket No. FAA-2007-28382], which is attached as an appendix to this directive, except regarding paragraph (h) of that document, which must be applied as follows:</p> <p>Maintenance Program Revision</p> <p>(g) Before 01 December 2007, revise the approved maintenance programme by incorporating the information of the sections specified in paragraphs (g)(1), (g)(2), (g)(3), and (g)(4) of the FAA AD, except that the initial inspection required by paragraph (h) of the FAA AD must be done at the applicable compliance time specified in the paragraph. Accomplishing the revision in accordance with a later revision of Document D6-8766-AWL is an acceptable method of compliance if the revision is approved by EASA directly or through Agency Decision 2004/04/CF by the FAA.</p>
Ref. Publications:	Boeing 727-100/200 Airworthiness Limitations (AWLs) Document, D6-8766-AWL, original release, dated March 2006.
Remarks :	<p>If requested and appropriately substantiated, EASA can accept Alternative Methods of Compliance for this AD.</p> <ol style="list-style-type: none"> The closing date for comments is 28 September 2007. Enquiries regarding this AD should be referred to the AD Focal Point - Certification Directorate, EASA. E-mail: ADs@easa.europa.eu. For any question concerning the technical content of the requirements in this AD, please contact: The Boeing Company, Fleet Support Engineering P.O. Box 3707, Seattle, Washington 98124-2207, United States of America; Telephone +1-425-237 0300; Facsimile +1-425-237 0352; E-mail csd.boecom@boeing.com; Website http://www.myboeingfleet.com.

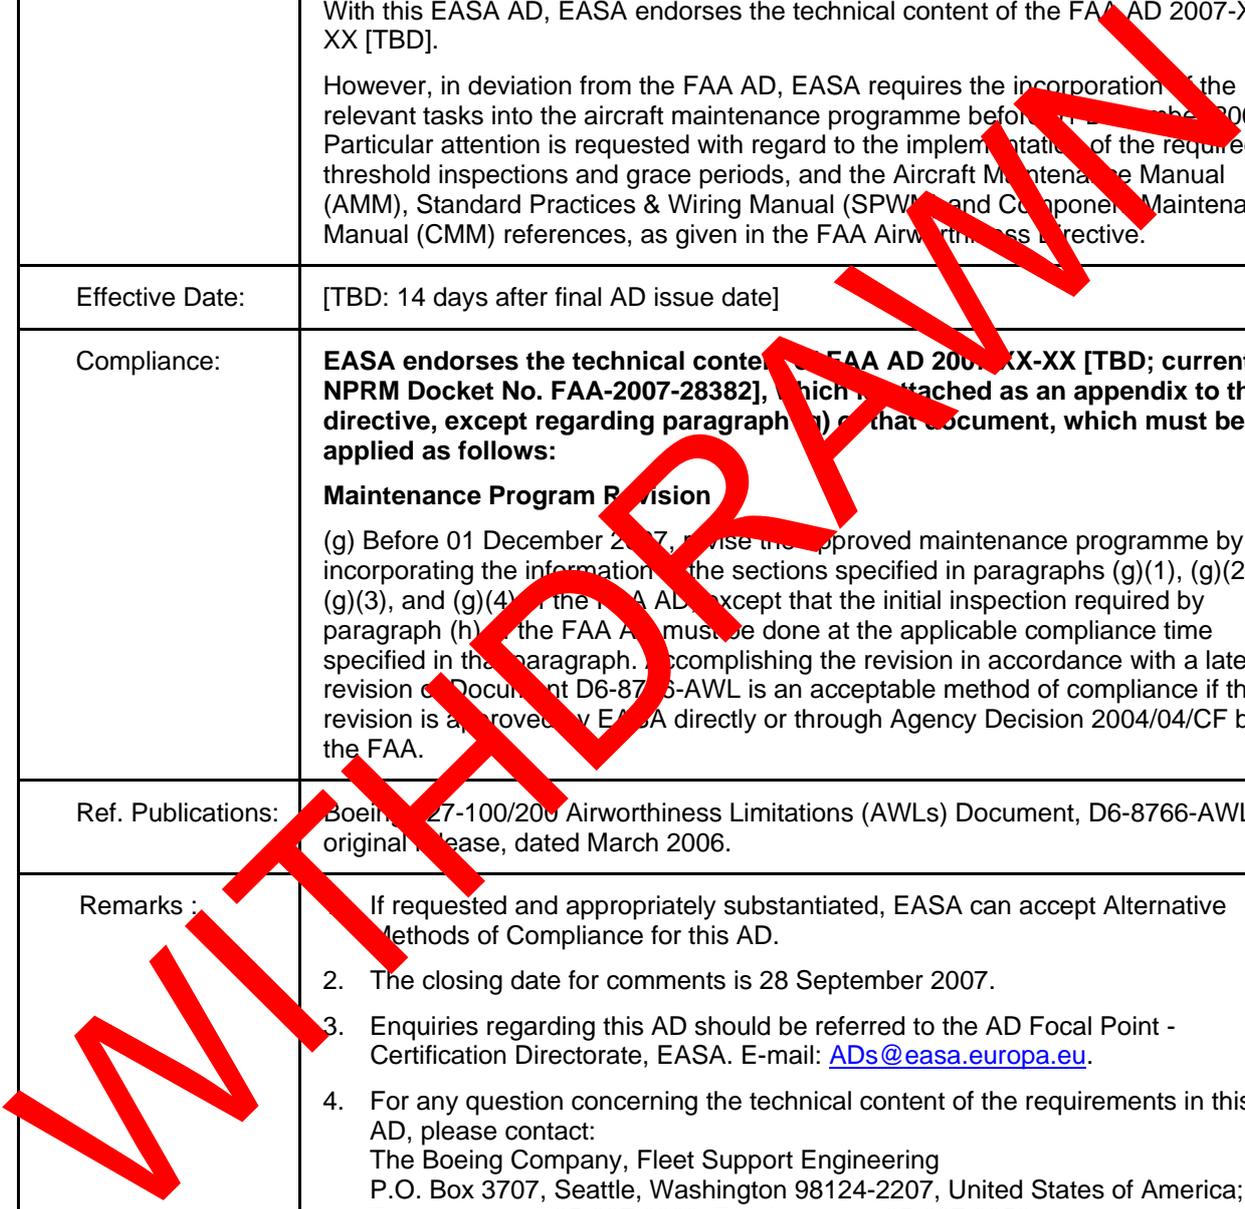

the economic and marketing conditions which relate to the proposed amendments of the order; (ii) determining whether there is a need for the proposed amendments to the order; and (iii) determining whether the proposed amendments or appropriate modifications thereof will tend to effectuate the declared policy of the Act.

Testimony is invited at the hearing on all the proposals and recommendations contained in this notice, as well as any appropriate modifications or alternatives.

All persons wishing to submit written material as evidence at the hearing should be prepared to submit four copies of such material at the hearing and should have prepared testimony available for presentation at the hearing.

From the time the notice of hearing is issued and until the issuance of a final decision in this proceeding, USDA employees involved in the decisional process are prohibited from discussing the merits of the hearing issues on an *ex parte* basis with any person having an interest in the proceeding. The prohibition applies to employees in the following organizational units: Office of the Secretary of Agriculture; Office of the Administrator, AMS; Office of the General Counsel, except any designated employee of the General Counsel assigned to represent the Board in this proceeding; and the Fruit and Vegetable Programs, AMS.

Procedural matters are not subject to the above prohibition and may be discussed at any time.

List of Subjects in 7 CFR Part 981

Almonds, Marketing agreements, Nuts, Reporting and recordkeeping requirements.

PART 981—ALMONDS GROWN IN CALIFORNIA

1. The authority citation for 7 CFR part 981 continues to read as follows:

Authority: 7 U.S.C. 1601–1604.

2. Testimony is invited on the following proposals or appropriate alternatives or modifications to such proposals.

Proposals submitted by the Almond Board of California:

Proposal Number 1

3. Add § 981.43 to read as follows:

§ 981.43 Marking or labeling of containers.

The Board may, with the approval of the Secretary, recommend regulations to require handlers to mark or label the containers that are used in packaging or handling almonds. Container means a box, bin, bag, carton, or any other type

of receptacle used in the packaging or handling of almonds.

Proposal Number 2

4. Revise § 981.42 by adding a new sentence at the end of paragraph (b) to read as follows:

§ 981.42 Quality control.

* * * * *

(b) * * * The Board may, with the approval of the Secretary, recommend different outgoing quality requirements for different markets. Proposal submitted by USDA:

Proposal Number 3

Make such changes as may be necessary to the order or its administrative rules and regulations to conform with any amendment that may result from the hearing.

Dated: June 29, 2007.

Lloyd C. Day,

Administrator, Agricultural Marketing Service.

[FR Doc. E7–13073 Filed 7–5–07; 8:45 am]

BILLING CODE 3410–02–P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA–2007–28382; Directorate Identifier 2006–NM–179–AD]

RIN 2120–AA64

Airworthiness Directives; Boeing Model 727 Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for all Boeing Model 727 airplanes. This proposed AD would require revising the FAA-approved maintenance program by incorporating new airworthiness limitations (AWLs) for fuel tank systems to satisfy Special Federal Aviation Regulation No. 88 requirements. This proposed AD would also require the initial inspection of a certain repetitive AWL inspection to phase in that inspection, and repair if necessary. This proposed AD results from a design review of the fuel tank systems. We are proposing this AD to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with

flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

DATES: We must receive comments on this proposed AD by August 20, 2007.

ADDRESSES: Use one of the following addresses to submit comments on this proposed AD.

- **DOT Docket Web site:** Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- **Government-wide rulemaking Web site:** Go to <http://www.regulations.gov> and follow the instructions for sending your comments electronically.

- **Mail:** U.S. Department of Transportation, Docket Operations, M–30, West Building Ground Floor, Room W12–140, 1215 New Jersey Avenue, SE., Washington, DC 20590.

- **Phone Delivery:** Room W12–140 on the ground floor of the West Building, 1200 New Jersey Avenue, SE., Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

Contact Boeing Commercial Airplanes, P.O. Box 3707, Seattle, Washington 98124–2207, for the service information identified in this proposed AD.

FOR FURTHER INFORMATION CONTACT: Kathrine Rask, Aerospace Engineer, Propulsion Branch, ANM–140S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue, SW., Renton, Washington 98057–3356; telephone (425) 917–6505; fax (425) 917–6590.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to submit any relevant written data, views, or arguments regarding this proposed AD. Send your comments to an address listed in the **ADDRESSES** section. Include the docket number “FAA–2007–28382; Directorate Identifier 2006–NM–179–AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of the proposed AD. We will consider all comments received by the closing date and may amend the proposed AD in light of those comments.

We will post all comments we receive, without change, to <http://dms.dot.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact with FAA personnel concerning this proposed AD. Using the search function of that Web site, anyone can find and read the comments in any of our dockets,

including the name of the individual who sent the comment (or signed the comment on behalf of an association, business, labor union, etc.). You may review DOT's complete Privacy Act Statement in the **Federal Register** published on April 11, 2000 (65 FR 19477-78), or you may visit <http://dms.dot.gov>.

Examining the Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>, or in person at the Docket Operations office between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The Docket Operations office (telephone (800) 647-5527) is located on the ground floor of the West Building at the DOT street address stated in the **ADDRESSES** section. Comments will be available in the AD docket shortly after the Docket Management System receives them.

Discussion

The FAA has examined the underlying safety issues involved in fuel tank explosions on several large transport airplanes, including the adequacy of existing regulations, the service history of airplanes subject to those regulations, and existing maintenance practices for fuel tank systems. As a result of those findings, we issued a regulation titled "Transport Airplane Fuel Tank System Design Review, Flammability Reduction and Maintenance and Inspection Requirements" (67 FR 23086, May 7, 2001). In addition to new airworthiness standards for transport airplanes and new maintenance requirements, this rule included Special Federal Aviation Regulation No. 88 ("SFAR 88," Amendment 21-78, and subsequent Amendments 21-82 and 21-83).

Among other actions, SFAR 88 requires certain type designees, i.e., type certificate (TC) and supplemental type certificate (STC) holders, to substantiate that their fuel tank systems can prevent ignition sources in the fuel tanks. This requirement applies to type design holders for large turbine-powered transport airplanes and for subsequent modifications to those airplanes. It requires them to perform design reviews and to develop design changes and maintenance procedures if their designs do not meet the new fuel tank safety standards. As explained in the preamble to the rule, we intended to adopt airworthiness directives to mandate any changes found necessary to address unsafe conditions identified as a result of these reviews.

In evaluating these design reviews, we have established four criteria intended

to define the unsafe conditions associated with fuel tank systems that require corrective actions. The percentage of operating time during which fuel tanks are exposed to flammable conditions is one of these criteria. The other three criteria address the failure types under evaluation: single failures, single failures in combination with another latent condition(s), and in-service failure experience. For all four criteria, the evaluations included consideration of previous actions taken that may mitigate the need for further action.

We have determined that the actions identified in this proposed AD are necessary to reduce the potential of ignition sources inside fuel tanks, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

Relevant Service Information

We have reviewed the following sections of Boeing 727-200 Airworthiness Limitations (AWLs), D6-8766-AWL, original release dated March 2006 (hereinafter referred to as "Document D6-8766-AWL"), for Model 727, 727C, 727-200, 727-200C, 727-200, and 727-200 series airplanes:

- Section A, "SCOPING"
 - Section B, "FUEL SYSTEMS AIRWORTHINESS LIMITATIONS"
 - Section C, "SYSTEM AWL PAGE FOR A"
 - Section D, "AIRWORTHINESS LIMITATIONS—FUEL SYSTEMS"
- These sections of Document D6-8766-AWL describe new AWLs for fuel tank systems. The new AWLs include:
- AWL inspections, which are periodic inspections of certain features for latent failures that could contribute to an ignition source; and
 - Critical design configuration control limitations (CDCCLs), which are limitation requirements to preserve a critical ignition source prevention feature of the fuel tank system design that is necessary to prevent the occurrence of an unsafe condition. The purpose of a CDCCL is to provide instruction to retain the critical ignition source prevention feature during configuration change that may be caused by alterations, repairs, or maintenance actions. A CDCCL is not a periodic inspection.

Accomplishing the actions specified in the service information is intended to adequately address the unsafe condition.

FAA's Determination and Requirements of the Proposed AD

We have evaluated all pertinent information and identified an unsafe condition that is likely to exist or develop on other airplanes of this same type design. For this reason, we are proposing this AD, which would require the FAA-approved maintenance program by incorporating the information in Section A, B, C, and D of Document D6-8766-AWL. This proposed AD would also require the initial inspection of certain repetitive AWL inspections, a phase of the inspection, and repair if necessary.

Difference Between Proposed AD and Service Bulletin

In most ADs, we adopt a compliance time allowing a specified amount of time after the AD's effective date. In this case, however, the FAA has already issued regulations that require operators to revise their maintenance/inspection programs to address fuel tank safety issues. The compliance date for these regulations is December 16, 2008. To provide for efficient and coordinated implementation of these regulations and this proposed AD, we are using this same compliance date in this proposed AD, instead of the 18-month compliance time recommended in the service bulletin.

Rework Required When Implementing AWLs Into an Existing Fleet

The maintenance program revision for the fuel tank systems specified in paragraph (g) of this proposed AD, which involves incorporating the information specified in Document D6-8766-AWL, would affect how operators maintain their airplanes. After doing that maintenance program revision, operators would need to do any maintenance on the fuel tank system as specified in the CDCCLs. Maintenance done before the maintenance program revision specified in paragraph (g) would not need to be redone in order to comply with paragraph (g). For example, the AWL that requires fuel pumps to be repaired and overhauled per an FAA-approved component maintenance manual (CMM) applies to fuel pumps repaired after the maintenance programs are revised; spare or on-wing fuel pumps do not need to be reworked. For AWLs that require repetitive inspections, the initial inspection interval (threshold) starts from the date the maintenance program revision specified in paragraph (g) is done, except as provided by paragraph (h) of this proposed AD. This proposed AD would require only the maintenance

program revision specified in paragraph (g), and initial inspections specified in paragraph (h). No other fleet-wide inspections need to be done.

Changes to Fuel Tank System AWLs

Paragraph (g) of this proposed AD would require revising the FAA-approved maintenance program by incorporating certain information specified in Document D6-8766-AWL. Paragraph (g) allows accomplishing the maintenance program revision in accordance with later revisions of the Document D6-8766-AWL as an acceptable method of compliance if they are approved by the Manager, Seattle Aircraft Certification Office (ACO), FAA. Paragraph (h) allows accomplishing the initial inspection and repair in accordance with later revisions of Document D6-8766-AWL as an acceptable method of compliance if they are approved by the Manager, Seattle ACO. In addition, Section B of Document D6-8766-AWL specifies that any deviations from the published AWL instructions, including AWL intervals, must be approved by the Manager, Seattle ACO. Therefore, after the maintenance program revision, any further revision to an AWL or AWL interval should be done as an AWL change, not as an alternative method of compliance (AMOC). For U.S.-registered airplanes, operators must make requests through an appropriate FAA Principal Maintenance Inspector (PMI) or Principal Avionics Inspector (PAI) for approval by the Manager, Seattle ACO. A non-U.S. operator should coordinate changes with its governing regulatory agency.

Exceptional Short-Term Extensions

Section B of Document D6-8766-AWL has provisions for an exceptional short-term extension of 3 days. An exceptional short-term extension is an increase in an AWL interval that may be needed to correct an uncontrollable or unexpected situation. For U.S.-registered airplanes, the FAA PMI or PAI must concur with any exceptional short-term extension before it is used, unless the operator has identified another appropriate procedure with the

local regulatory authority. The FAA PMI or PAI may grant the exceptional short-term extensions described in Section B without consultation with the Manager, Seattle ACO. A non-U.S. operator should coordinate changes with its governing regulatory agency. As explained in Document D6-8766-AWL, exceptional short-term extensions must not be used for fleet AWL extensions. An exceptional short-term extension should not be confused with an operator's short-term escalation authorization approved in accordance with the Operations Specifications or the operator's reliability program.

Ensuring Compliance With Fuel Tank System AWLs

Boeing has revised applicable maintenance manuals and task cards to address AWLs and to include notes about CDCCLs. Operators that do not use Boeing's revision service should revise their maintenance manuals and task cards to highlight actions tied to CDCCLs to ensure that maintenance personnel are complying with the CDCCLs. Appendix B of this proposed AD contains a list of Air Transport Association (ATA) sections for the revised maintenance manuals. Operators might wish to use the appendix as an aid to implement the AWLs.

Recording Compliance With Fuel Tank System AWLs

The applicable operating rules of the Federal Aviation Regulations (14 CFR parts 91, 121, 125, and 129) require operators to maintain records with the identification of the current inspection status of an airplane. Some of the AWLs contained in Section D of Document D6-8766-AWL are inspections for which the applicable sections of the operating rules apply. Other AWLs are CDCCLs, which are tied to conditional maintenance actions. An entry into an operator's existing maintenance record system for corrective action is sufficient for recording compliance with CDCCLs, as long as the applicable maintenance manual and task cards identify actions that are CDCCLs.

Changes to CMMs Cited in Fuel Tank System AWLs

Some of the AWLs in Section D of Document D6-8766-AWL refer to specific revision levels of the CMMs as additional sources of service information for doing the AWLs. Boeing is referring to the CMMs by revision level in the applicable AWL for certain components rather than including information directly in Document D6-8766-AWL because of the volume of that information. As a result, the Manager, Seattle ACO, must approve the CMMs. Any later revision of the CMMs will be handled like a change to the AWL itself. Any use of parts (including the use of parts manufacturer approved (PMA) approved parts), methods, techniques, and practices not contained in the CMMs need to be approved by the Manager, Seattle ACO, or governing regulatory authority. For example, pump repair/overhaul manuals must be approved by the Manager, Seattle ACO.

Changes to AMMs Referenced in Fuel Tank System AWLs

In other AWLs in Section D of Document D6-8766-AWL, the AWLs contain all the necessary data. The applicable section of the maintenance manual is usually included in the AWLs. Boeing intended this information to assist operators in maintaining the maintenance manuals. A maintenance manual change to these tasks may be made without approval by the Manager, Seattle ACO, through an appropriate FAA PMI or PAI, by the governing regulatory authority, or by using the operator's standard process for revising maintenance manuals. An acceptable change would have to maintain the information specified in the AWL such as the pass/fail criteria or special test equipment.

Costs of Compliance

There are about 530 airplanes of the affected design in the worldwide fleet. The following table provides the estimated costs, at an average labor rate of \$80 per hour, for U.S. operators to comply with this proposed AD.

ESTIMATED COSTS

Action	Work hours	Parts	Cost per airplane	Number of U.S.-registered airplanes	Fleet cost
Maintenance program revision	8	None	\$640	272	\$174,080
Inspection	8	None	640	272	174,080

Authority for This Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, Section 106, describes the authority of the FAA Administrator. Subtitle VII, Aviation Programs, describes in more detail the scope of the Agency's authority.

We are issuing this rulemaking under the authority described in subtitle VII, part A, subpart III, section 44701, "General requirements." Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We have determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that the proposed regulation:

- 1. Is not a "significant regulatory action" under Executive Order 12866;
2. Is not a "significant rule" under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979); and
3. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

We prepared a regulatory evaluation of the estimated costs to comply with this proposed AD and placed it in the AD docket. See the ADDRESSES section for a location to examine the regulatory evaluation.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39—AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The Federal Aviation Administration (FAA) amends § 39.13 by adding the following new airworthiness directive (AD):

Boeing: Docket No. FAA-2007-28382; Directorate Identifier 2006-NM-179-AD.

Comments Due Date

(a) The FAA must receive comments on this AD action by August 20, 2007.

Affected ADs

(b) None.

Applicability

(c) This AD applies to all Boeing Model 727, 727C, 727-100, 727-100C, 727-200, and 727-200F series airplanes, certificate of registry category.

Note 1: This AD requires revisions to certain operator maintenance documents to include new inspections and maintenance actions. Compliance with these limitations required by 14 CFR 43.16 and 91.403(c). For airplanes that have been previously modified, altered, or repaired in the areas addressed by these limitations, the operator may not be able to comply with the actions described in the revisions. In this situation, to comply with 14 CFR 43.16 and 91.403(c), the operator must request approval for repair to the airworthiness limitations in the Boeing 727-100/200 Airworthiness Limitations (AWL) D6-8766-AWL, according to paragraph (g) or (i) of this AD, as applicable.

Unsafe Condition

(d) This AD results from a design review of the fuel tank systems. We are issuing this AD to prevent the potential for ignition sources inside fuel tanks caused by latent failures, alterations, repairs, or maintenance actions, which, in combination with flammable fuel vapors, could result in a fuel tank explosion and consequent loss of the airplane.

Compliance

(e) You are responsible for having the actions required by this AD performed within the compliance times specified, unless the actions have already been done.

Service Information Reference

(f) The term "Document D6-8766-AWL" as used in this AD, means Boeing 727-100/200 Airworthiness Limitations (AWLs), D6-8766-AWL, original release, dated March 2006.

Maintenance Program Revision

(g) Before December 16, 2008, revise the FAA-approved maintenance program to incorporate the information in the sections specified in paragraphs (g)(1), (g)(2), (g)(3), and (g)(4) of this AD; except that the initial

inspection required by paragraph (h) of this AD must be done at the applicable compliance time specified in that paragraph. Accomplishing the revision in accordance with a later revision of Document D6-8766-AWL is an acceptable method of compliance if the revision is approved by the Manager, Seattle Aircraft Certification Office (ACO), FAA.

(1) Section A, "SCOPE" of Document D6-8766-AWL.

(2) Section B, "FUEL SYSTEMS AIRWORTHINESS LIMITATIONS," of Document D6-8766-AWL.

(3) Section C, "SYSTEM AWL PAGE FORMAT," of Document D6-8766-AWL.

(4) Section D, "AIRWORTHINESS LIMITATIONS—FUEL SYSTEMS," of Document D6-8766-AWL.

Initial Inspection and Report if Necessary

(h) At the end of the compliance times specified in paragraphs (h)(1) and (h)(2) of this AD, do a detailed inspection of the wire bundles routed over the center fuel tank for damaged wire caps, wire chafing, and wire bundles in contact with the surface of the center fuel tank, in accordance with AWL Number 28-AWL-01 of Section D of Document D6-8766-AWL. If any discrepancy is found during the inspection, repair the discrepancy before further flight in accordance with AWL Number 28-AWL-01 of Section D of Document D6-8766-AWL. Accomplishing the actions required by this paragraph in accordance with a later revision of Document D6-8766-AWL is an acceptable method of compliance if the revision is approved by the Manager, Seattle ACO.

Note 2: For the purposes of this AD, a detailed inspection is: "An intensive examination of a specific item, installation, or assembly to detect damage, failure, or irregularity. Available lighting is normally supplemented with a direct source of good lighting at an intensity deemed appropriate. Inspection aids such as mirror, magnifying lenses, etc., may be necessary. Surface cleaning and elaborate procedures may be required."

(1) Prior to the accumulation of 36,000 total flight hours, or within 120 months since the date of issuance of the original standard airworthiness certification or the date of issuance of the original export certificate of airworthiness, whichever ever occurs first.

(2) Within 72 months after the effective date of this AD.


Alternative Methods of Compliance (AMOCs)

(i)(1) The Manager, Seattle ACO, has the authority to approve AMOCs for this AD, if requested in accordance with the procedures found in 14 CFR 39.19.

(2) To request a different method of compliance or a different compliance time for this AD, follow the procedures in 14 CFR 39.19. Before using any approved AMOC on any airplane to which the AMOC applies, notify your appropriate principal inspector (PI) in the FAA Flight Standards District Office (FSDO), or lacking a PI, your local FSDO.

APPENDIX 1.—IMPLEMENTING FUEL TANK SYSTEM AIRWORTHINESS LIMITATIONS ON MODEL 727, 727C, 727-100, 727-100C, 727-200, 727-200F SERIES AIRPLANES

AWL No.	ALI/CDCCL	ATA section or CMM document	Task title
28-AWL-01	ALI	AMM 28-11-00/601	External Wires Over the Tank No. 2 Inspection.
28-AWL-02	CDCCL	SWPM 20-10-11	Wiring Assembly and Installation Configuration.
28-AWL-03	CDCCL	SWPM 20-10-11	Wiring Assembly and Installation Configuration.
28-AWL-04	CDCCL	CMM 28-41-01, Revision 12; CMM 28-41-02, Revision 5; CMM 28-41-03, Revision 3; CMM 28-41-06, Revision 8; CMM 28-41-07, Revision 17; CMM 28-41-08, Revision 9; CMM 28-41-09, Revision 8; CMM 28-41-23, Revision 10; or subsequent revisions.	
28-AWL-05	CDCCL	CMM 28-40-03, Revision 5; CMM 28-41-06, Revision 8; or subsequent revisions.	
28-AWL-06	CDCCL	SWPM 20-14-12	Repair Fuel Quantity Indicator System (FQIS) Wiring Harness.
		AMM 28-41-21/401	Remove/Install Fuel Tank Bulkhead (Spar) Receiver Wire Harness.
28-AWL-07	CDCCL	AMM 29-11-53/401	Install System A Hydraulic Fluid Heat Exchanger.
		AMM 29-12-61/401	Install System B Hydraulic Fluid Heat Exchanger.
28-AWL-08	CDCCL		
28-AWL-09	CDCCL	CMM 28-20-1, Revision 7; CMM 28-20-2, Revision 6; CMM 28-20-06, Revision 10; or subsequent revisions.	
28-AWL-10	CDCCL	AMM 28-22-21/401	Install Fuel Boost Pump.
28-AWL-11	CDCCL	AMM 28-21-93/401	Remove the Auxiliary Tank Fueling Float Switch.
		AMM 28-21-94/401	Install the Auxiliary Tank Fueling Float Switch.
28-AWL-12	CDCCL	AMM 28-11-21/401	Removal/Installation Cast Fuel Tank Access Panels.
28-AWL-13	CDCCL	AMM 28-11-21/401	Removal/Installation Machined Fuel Tank Access Panels.
		AMM 28-13-11/401	Install the Relief Valve.
28-AWL-14	CDCCL	AMM 28-22-21/401	Fuel Boost Pump—Inspection/Check.
28-AWL-15	CDCCL	AMM 28-12-00/401	Engine Fuel Feed System—Trouble Shooting.

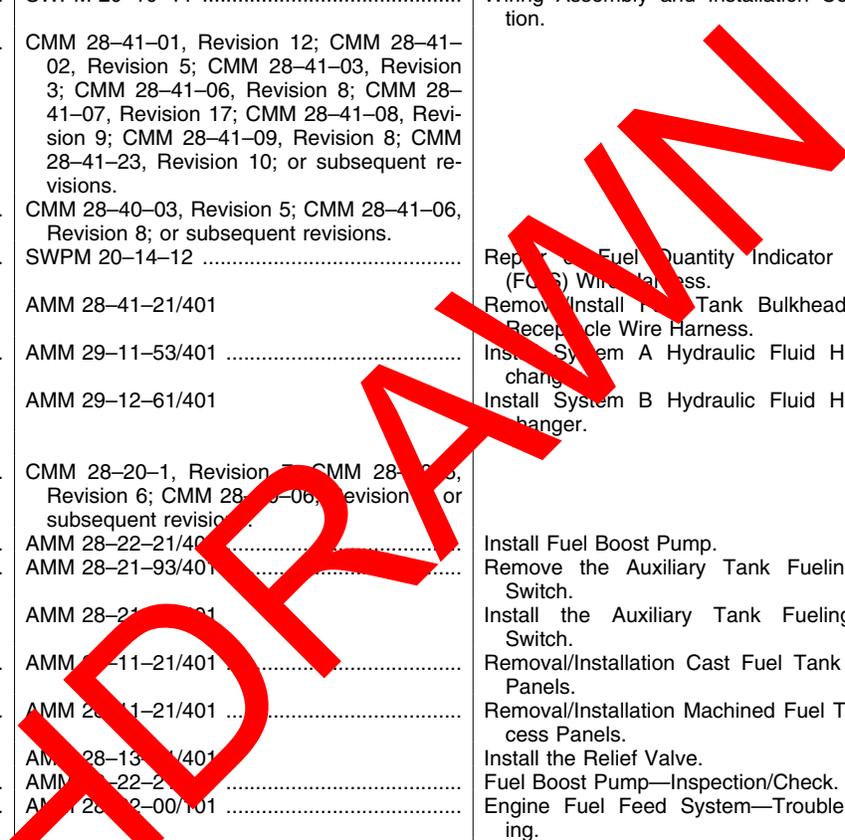

Issued in Renton, Washington, on June 22, 2007.

Ali Bahrami,

Manager, Transport Aircraft Directorate, Aircraft Certification Service.

[FR Doc. E7-13115 Filed 7-5-07; 15 am]

BILLING CODE 4910-3-P

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2007-28436; Directorate Identifier 2007-CE-055-AD]

RIN 2120-AA64

Airworthiness Directives; Pacific Aerospace Limited Model 750XL Airplanes

AGENCY: Federal Aviation Administration (FAA), Department of Transportation (DOT).

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for the products listed above. This proposed AD results from mandatory continuing airworthiness information (MCAI) originated by an aviation authority of another country to identify and correct an unsafe condition on an aviation product. The MCAI describes the unsafe condition as:

To prevent cracks developing in the aileron spar adjacent to the inboard hinge attachment * * *

The proposed AD would require actions that are intended to address the unsafe condition described in the MCAI.

DATES: We must receive comments on this proposed AD by August 6, 2007.

ADDRESSES: You may send comments by any of the following methods:

- **DOT Docket Web Site:** Go to <http://dms.dot.gov> and follow the instructions for sending your comments electronically.

- **Fax:** (202) 493-2251.

- **Mail:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590.

- **Hand Delivery:** U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue, SE., Washington, DC 20590, between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

- **Federal eRulemaking Portal:** Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://dms.dot.gov>; or in person at the Docket Management