


<b>EASA</b>	<b>PROPOSED AIRWORTHINESS DIRECTIVE</b>
	<p><b>PAD No.: 07 - 209</b></p> <p><b>Date: 22 November 2007</b></p>
No person may operate an aircraft to which an Airworthiness Directive applies, except in accordance with the requirements of that Airworthiness Directive unless otherwise agreed with the Authority of the State of Registry.	
<b>Type Approval Holder's Name :</b> AIRBUS	<b>Type/Model designation(s) :</b> A319, A320 and A321 aircraft
TCDS Number: EASA A.064	
Foreign AD: Not applicable	
Supersedure: None	
<b>ATA 32</b>	<b>Landing Gear – Braking and Steering Control Unit (BSCU) – Modification / Replacement</b>
Manufacturer(s):	AIRBUS (formerly AIRBUS INDUSTRIE)
Applicability:	<p>AIRBUS A319-111, A319-112, A319-113, A319-114, A319-115, A319-131, A319-132, A319-133, A320-111, A320-211, A320-212, A320-214, A320-215, A320-216, A320-231, A320-232, A320-233, A321-111, A321-112, A321-131, A321-211, A321-212, A321-213, A321-231, A321-232 that are equipped with one conventional pre Enhanced Manufacture and Maintainability (pre-EMM) Braking and Steering Control Unit (BSCU) part number (PN) :</p> <ul style="list-style-type: none"> <li>- C20216332292C (standard 7) installed by AIRBUS modification 24449 in production or by AIRBUS Service Bulletin (SB) A320-32-1124 in service, or</li> <li>- C202163372D32 (standard 9) installed by modification 31106 in production or by SB A320-32-1227 or SB A320-32-1232 in service, or</li> <li>- C202163382D32 (standard 9.1) installed by modification 32500 in production or by SB A320-32-1254 in service.</li> </ul>
Reason:	In 2005 a lateral runway excursion occurred on an A320 aircraft. Investigation has shown that the aircraft landed with the nose wheels rotated of nearly 20 degrees from center. During subsequent tests on the removed BSCU, a BSCU hardware failure was found, affecting the

	<p>monitoring function, including the system reconfiguration management, and leading to a runaway of Nose Wheel Steering.</p> <p>DGAC Airworthiness Directive (AD) F-1992-117-025(B) Revision 1, mandated the BSCU upgrade in order to improve the steering logic, but this modification has shown not to be sufficient.</p> <p>A software modification is now implemented in BSCU standard 10 which improves the system reconfiguration management.</p> <p>BSCU standard 10 also includes other improvements.</p> <p>This AD therefore mandates the modification or replacement of the BSCU standard 7, 9 or 9.1 by the BSCU standard 10.</p>
Effective Date:	Proposed: 14 days after final AD issue date.
Compliance:	<p>Before 30 September 2009, modify or replace the BSCU in accordance with the instructions given in SB A320-32-1336 to install BSCU standard 10.</p> <p>BSCU standard 10 is not compatible with DUNLOP tyres 46x16-20 Part Numbers 11659 T and 11661 T, reference SB A320-32-1336, paragraph 1.A.(2).(a). Therefore, these tyres may not be installed on an aircraft with BSCU standard 10. Upon installation of BSCU standard 10, as required by this AD, any such installed tyres must be replaced with acceptable units at the same time.</p> <p>Note: it is the responsibility of the operator to ensure that any BSCU or tyres replaced on aircraft after having complied with this AD, still complies with the requirements of this AD.</p>
Ref. Publications:	<p>AIRBUS Service Bulletin A320-32-1336 original issue.</p> <p>The use of later approved revisions is acceptable for compliance with the requirements of this AD.</p>
Remarks :	<ol style="list-style-type: none"> <li>1. If requested and appropriately substantiated, EASA can accept Alternative Methods of Compliance for this AD.</li> <li>2. The closing date for comments is 19 December 2007.</li> <li>3. Enquiries regarding this Airworthiness Directive should be referred to the AD Focal Point - Certification Directorate, EASA. E-mail: <a href="mailto:ADs@easa.europa.eu">ADs@easa.europa.eu</a> .</li> <li>4. For any question concerning the technical content of the requirements in this AD, please contact: AIRBUS – Airworthiness Office – EAS Fax +33 5 61 93 44 51, E-mail: <a href="mailto:airworth-eas@airbus.com">airworth-eas@airbus.com</a>.</li> </ol>